1240095 [0075219H]

> HNF-EP-0182 Revision 343

Waste Tank Summary Report for Month Ending July 31, 2016

Prepared for the U.S. Department of Energy Assistant Secretary for Environmental Management

Contractor for the U.S. Department of Energy
Office of River Protection under Contract DE-AC27-08RV14800



P.O. Box 850 Richland, Washington



DOCUMENT RELEASE AND CHANGE FORM

Prepared For the U.S. Department of Energy, Assistant Secretary for Environmental Management By Washington River Protection Solutions, LLC., PO Box 850, Richland, WA 99352 Contractor For U.S. Department of Energy, Office of River Protection, under Contract DE-AC27-08RV14800

TRADEMARK DISCLAIMER: Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States government or any agency thereof or its contractors or subcontractors. Printed in the United States of America.

1. Doc No: HNF-EP-0182 Rev. 343

ı	2.	Ti	н	e:
ı	2.			о.

Waste Tank Summary Report for Month Ending July 31, 2016

3. Project Number: ⊠ N/A 4. Design Verification Required: □ Yes ⊠ No

5. USQ Number: 🗵 N/A

☑ N/A 6. **PrHA Number** RPP-27195 DATE:
Aug 30, 2016
RELEASE

Clearance Review Restriction Type: public

7. Approva	s
------------	---

Title	Name	Signature	Date
Clearance Review	RAYMER, JULIA R	RAYMER, JULIA R	08/30/2016
Document Control Approval	WASHINGTON, MARGUERITE	WASHINGTON, MARGUERITE	08/30/2016
Originator	TEMPLETON, ANDREW M	TEMPLETON, ANDREW M	08/24/2016
Other Approver	WASHENFELDER, DENNIS	WASHENFELDER, DENNIS	08/23/2016
Other Approver	SCHOFIELD, JOHN	TEMPLETON, ANDREW M for SCHOFIELD, JOHN per email	08/29/2016
Other Approver	RODGERS, MATT J	RODGERS, MATT J	08/29/2016
Responsible Manager	BAUNE, HEATHER L	BAUNE, HEATHER L	08/29/2016

Rev.

⊠ N/A

8. Description of Change and Justification

Complete Revision - Tables and text updated each month to reflect revised status.

DOE-ORP requires this document to be revised and issued monthly.

9. TBDs or Holds

⊠ N/A

l O	Related	Structures	Systems	and	Components

a. Related Building/Facilities	⊠ N/A	b. Related Systems	⊠ N/A	c. Related Equipment ID Nos. (EIN)	⊠ N/A
	N 16260 U				

11. Impacted Documents - Engineering

⊠ N/A

Document Number	Rev.	Title
	887	+

12. Impacted Documents (Outside SPF):

N/A

13. Related Documents

⊠ N/A

Document Number	Rev.	litle	
			50 (20%)
			* * * * * * * * * * * * * * * * * * * *

14. Distribution

Name	Organization
ANDERSON, MASON A	TNK WST INVENTORY & CHARACTZTN
BAUNE, HEATHER L	222S LABORATORY ENGINEERING
CRAWFORD, JORDAN T	TNK WST INVENTORY & CHARACTZTN
DETRICH, ELIZABETH J	TNK WST INVENTORY & CHARACTZTN
FERRITER, SEAN D	TNK WST INVENTORY & CHARACTZTN
KADINGER, JENNIFER A	TNK WST INVENTORY & CHARACTZTN
LUKE, SCOTT N	TNK WST INVENTORY & CHARACTZTN
NGUYEN, DUC M	TNK WST INVENTORY & CHARACTZTN
RASMUSSEN, JUERGEN H	TNK WST INVENTORY & CHARACTZTN
RODGERS, MATT J	TNK WST INVENTORY & CHARACTZTN
SAMS, TERRY L	PROCESS ENGINEERING ANALYSIS
SCHOFIELD, JOHN	TANK AND PIPELINE INTEGRITY
STURMAN, GRANT A	TNK WST INVENTORY & CHARACTZTN
TEMPLETON, ANDREW M	TNK WST INVENTORY & CHARACTZTN
WASHENFELDER, DENNIS	TANK AND PIPELINE INTEGRITY

INFORMA	TION CLEARANG	CE RE	EVIE	W AND RE	ELEASE	APPROVAL
Part I: Background Informati	on	-				
Title: Waste Tank Summary Month Ending July 31,			ion Ca stract ernet		al Article Aid	
Publish to OSTI? ☐ Yes ☑	No	☐ Ful	l Pape	r 🗹 Report	t 🗆	Other Yes NA
Trademark/Copyright "Right to Use" Inf		cumental	tion		4	□ ☑
Document Number: HNF-EP-0182 F	Revision 343					Date: August 2016 08/25/2016
Author: Templeton, Andrew M						
Part II: External/Public Prese	ntation information					
Conference Name:	5	_			· · · · · · · · · · · · · · · · · · ·	*
Sponsoring Organization(s): Date of Conference:	Conformed Landii					
	Conference Location		-			(If Yes, attach copy of Conference
Will Material be Handed Out? Yes		ion be P	ublishe	ed? Yes	☑ No	format instructions/guidance.)
Part III: WRPS Document Orig						
Description		Yes	-			Print/Sign/Date
Information Product meets requirement			Ø			
Document Release Criteria in TFC-ENG (Attach checklist)		■		Templeton, /	Andrew M	Approved via att. IDMS data file.
If product contains pictures, safety review			V			
Part IV: WRPS Internal Revie						
Function	Organization		D	ate	Print Name/	Signature/Date
Subject Matter Expert	WRPS		_			n, Andrew M Approved via att. IDMS data file.
Responsible Manager	WRPS				Baune, H	leather L Approved via att. IDMS data file.
Other:						
Part V: IRM Clearance Service			1 64-			
Description		Yes	No			nt Name/Signature
Document Contains Classified Informat	ion?		₩	If Answer is "Ye	es," ADC App	proval Required
						Name/Signature/Date
Document Contains Information Restrict Security Guidelines?	ted by DOE Operational		X	Reviewer Signa	ature:	
					Print N	Name/Signature/Date
Document is Subject to Release Restrict	ctions?			Document conf		
If the answer is "Yes," please mark cate limitation or responsible organization be				☐ Applied To	echnology	☐ Protected CRADA
initiation of responsible organization be	now.			☐ Personal/	Private	☐ Export Controlled
				☐ Proprietar	у	☐ Procurement – Sensitive
				☐ Patentable	e Info.	□ 000
				☐ Predecisio	onal Info.	☐ UCNI
				☐ Restricted☐ Other (Sp		nal Security Guidelines
Additional Comment of the first	01		Para			
Additional Comments from Information Review?	olearance Specialist		×	Information Cle	earance Spec	cialist Approval
					lia Raymer at 10:39 an	
			L		Print N	lame/Signature/Date

When IRM Clearance Review is Complete - Return to WRPS Originator for Final Signature Routing (Part VI)

Date Information Product Stamped/Marked for Release: 8/25/2016

Was/Is Information Product Transferred to OSTI?

INFORMATION	CLEARAN	ICE REV	VIEW AND RELEASE APPROVAL
Part VI: Final Review and Approvals			
Description	Approved for	or Release	Print Name/Signature
Description	Yes	N/A	r mit Namer Signature
WRPS External Affairs			Approved via att. IDMS data file.
WRPS Office of Chief Counsel	V		Approved via att. IDMS data file.
DOE - ORP Public Affairs/Communications	1		Approved via att. IDMS data file.
Other: ORP SME	₩ .		Approved via att. IDMS data file.
Other: Comments Required for WRPS-Indicate Purpose			
underground waste storage tank special surveillance facilities, and and ongoing investigations. This	s and sma d supplem s report is i	ller misc ental info ntendec	cellaneous underground storage tanks (MUST) and cormation regarding tank surveillance anomalies of to meet the requirement of DOE O 435.1, corting of tank waste volumes and space utilization APPROVED By Julia Raymer at 10:41 am. Aug 25, 2016 Approved for Public Release; Further Dissemination Unlimited
			No
Was/Is Information Product Approved for Rele If Yes, what is the Level of Releaser?	ease? 🗹 Yes	_	No Other (Specify)

☐ Yes ☑ No

Forward Copies of Completed Form to WRPS Originator

```
- <workflow name="(JRR) HNF-EP-0182-343 (Expedite)" id="209995872">
 - <task name="Clearance Process" id="0" date-initiated="20160818T1425"</p>
     performer="Julia R Raymer" performer-id="164931488" username="h3310581">
     <comments>*Please Expedite* Please review HNF-EP-0182, Rev. 343, for
      public release by noon on 8/25/16 (Thursday). POC: Andrew Templeton
      (509) 373-5589 Thank you, Julia Raymer (509) 373-0230</comments>
   </task>
   <task name="Add XML" id="1" date-done="20160818T1425" />
 - <task name="Expedite - Manager Approval" id="6" date-due="20160822T1425"</p>
    date-done="20160818T1433" performer="Heather L Baune" performer-
    id="141017875" username="h2790307" disposition="Approve"
    authentication="true">
     <comments>No comments.</comments>
   <task name="Expedite - Document Reviewer2" id="17" date-
    due="20160822T1433" date-done="20160822T1343" performer="Mari L Roden"
    performer-id="179713158" username="h0048955" disposition="Public Release"
    authentication="true" />
 - <task name="Expedite - Document Reviewer1" id="16" date-</p>
    due="20160822T1433" date-done="20160823T0638" performer="Rob T
    Roxburgh" performer-id="145327495" username="h6879768" disposition="Public
    Release" authentication="true">
    <comments>P. 61: Annette Cary's name is misspelled. Reads: Carey. Should
      read: Carv.</comments>
   </task>
 - <task name="Doc Owner Clearance Review" id="13" date-due="20160824T0638"</p>
    date-done="20160823T1036" performer="Andrew M Templeton" performer-
    id="1078791" username="h0091402" disposition="Send On" authentication="true">
    <comments>I have incorporated R. Roxburgh comments and the most recent
      version of the document has been uploaded.</comments>
   </task>
   <task name="Milestone 1" id="24" date-done="20160823T1036" />
 - <task name="ORP Document Reviewer1" id="57" date-due="20160825T1036" date-
    done="20160823T1622" performer="Richard A Marshall" performer-
    id="203862915" username="h4535783" disposition="Public Release"
    authentication="true">
    <reviewer performer="Jeremy M Johnson" performer-id="140884110"</pre>
      username="h6255457" />
    <comments>Reviewer's Comments Date: 08/23/2016 02:33 PM Step Name:
      HNF-EP-0182 Rev 343 Waste Tank Monthly Summary Report for Month
      Ending July 31, 2016 Performer: Johnson, Jeremy (h6255457) Approve
      release</comments>
   </task>
 - <task name="Doc Owner Reviews ORP Comments" id="61" date-</p>
    due="20160824T1622" date-done="20160823T1729" performer="Andrew M
    Templeton" performer-id="1078791" username="h0091402" disposition="Send On"
    authentication="true">
    <comments>No additional comments</comments>
  </task>
  <task name="Milestone 2" id="62" date-done="20160823T1729" />
  <task name="Verify Doc Consistency" id="4" date-due="20160824T1729" date-
    done="20160825T1034" performer="Julia R Raymer" performer-id="164931488"
    username="h3310581" disposition="Cleared" authentication="true" />
 </workflow>
```

HNF-EP-0182, Rev. 343

WASTE TANK SUMMARY REPORT FOR MONTH ENDING JULY 31, 2016

A. M. Templeton

WASHINGTON RIVER PROTECTION SOLUTIONS Richland, WA 99352 U.S. Department of Energy Contract DE-AC27-08RV14800

EDT/ECN:

DRCF

UC: N/A

Cost Center: 2KL0

2KL00

Charge Code: 202352

B&R Code:


N/A

Total Pages:

Key Words: MONTHLY REPORT, WASTE TANK SUMMARY, DST, SST

Abstract: This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report is intended to meet the requirement of DOE O 435.1, Radioactive Waste Management, requiring the reporting of tank waste volume inventories and space utilization for the Hanford Site tank farms.

TRADEMARK DISCLAIMER. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors.

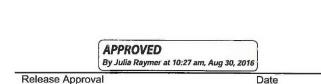



Approved For Public Release

RECORD OF REVISION

Date	Revision	Description	Changed by
1/24/2001	153	EDT-631372	B. M. Hanlon
		Record of revision truncated for brevity	
9/15/2014	318	Incorporation of DRF (Full Revision)	M. J. Rodgers
9/25/2014	319	Complete revision	D. I. Weyns
10/27/2014	320	Complete revision	D. I. Weyns
11/12/2014	321	Complete revision	D. I. Weyns
12/17/2014	322	Complete revision	D. I. Weyns
1/13/2015	323	Complete revision	D. I. Weyns
2/11/2015	324	Complete revision	M. J. Rodgers
3/12/2015	325	Complete revision	M. J. Rodgers
4/9/2015	326	Complete revision	M. J. Rodgers
5/7/2015	327	Complete revision	M. J. Rodgers
6/9/2015	328	Complete revision	M. J. Rodgers
7/13/2015	329	Complete revision	M. J. Rodgers
8/11/2015	330	Complete revision	A. M. Templeton
9/9/2015	331	Complete revision	A. M. Templeton
10/7/2015	332	Complete revision	A. M. Templeton
11/9/2015	333	Complete revision	A. M. Templeton
12/2/2015	334	Complete revision	A. M. Templeton
1/14/2016	335	Complete revision	A. M. Templeton
2/9/2016	336	Complete revision	A. M. Templeton
3/10/2016	337	Complete revision	A. M. Templeton
4/13/2016	338	Complete revision	A. M. Templeton
5/9/2016	339	Complete revision	A. M. Templeton
6/2/2016	340	Complete revision	A. M. Templeton
6/30/2016	341	Complete revision	A. M. Templeton
7/27/2016	342	Complete revision	A. M. Templeton
8/29/2016	RS 343	Complete revision	A. M. Templeton

Waste Tank Summary Report for Month Ending July 31, 2016

A. M. Templeton
Washington River Protection Solutions, LLC

Date Published August 2016

Prepared for the U.S. Department of Energy Assistant Secretary for Environmental Management

Contractor for the U.S. Department of Energy
Office of River Protection under Contract DE-AC27-08RV14800



P.O. Box 850 Richland, Washington

Approved for Public Release; Further Dissemination Unlimited

TRADEMARK DISCLAIMER

Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors.

This report has been reproduced from the best available copy. Available in paper copy.

Printed in the United States of America

CONTENTS

1.0	PUR	POSE AND SCOPE	
	1.1	Description of Table 1-1 Changes from Last Report	
2.0	TAN	K WASTE RETRIEVAL STATUS HIGHLIGHTS	9
3.0	DOU	BLE-SHELL TANKS MONTHLY SUMMARY TABLES	11
4.0	SINC 4.1	LE-SHELL TANKS MONTHLY SUMMARY TABLESLeak Volume Estimates	
	4.2	Water Intrusion in Single-Shell Tanks	24
5.0		CELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL VEILLANCE FACILITIES	27
6.0	END	NOTES AND REFERENCES	33
	6.1	Report Endnotes	33
	6.2	References	41
		APPENDIX	
Appe	ndix A	- Glossary	A-1

FIGURES

Figure 1-1.	Double-Shell Tank Configuration	
Figure 1-2.	Single-Shell Tank Configuration	3
Figure 1-3.	200 East Area Tank Waste Contents	4
Figure 1-4.	200 West Area Tank Waste Contents	
	TABLES	
Table 1-1.	Waste Tank Summary – July 31, 2016	2
Table 2-1.	Tanks in Retrieval Status	9
Table 3-1.	Inventory and Status by Tanks – Double-Shell Tanks (2 pages)	11
Table 3-2.	Double-Shell Tank Space Allocation, Inventory and Waste Receipts	13
Table 4-1.	Inventory and Status by Tanks – Single-Shell Tanks (6 pages)	15
Table 4-2.	Tank Leak Volume Estimates (3 pages)	21
Table 4-3.	DST Primary Tank Leak Volume Estimates	23
Table 4-4.	Single-Shell Tanks with Confirmed Water Intrusion	24
Table 4-5.	Single-Shell Tanks with Evidence of Recent Water Intrusion	25
Table 5-1.	200 East Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (3 pages)	27
Table 5-2.	200 West Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (3 pages)	30
Table 6-1.	Waste Tank Summary Report Endnotes (8 pages)	33

TERMS

Acronyms

BBI best-basis inventory

DCRT double-contained receiver tank DOE U.S. Department of Energy

DST double-shell tank

Ecology State of Washington, Department of Ecology

HEPA high-efficiency particulate air

HVAC heating, ventilation, and air conditioning MUST miscellaneous underground storage tank

ORP U.S. Department of Energy, Office of River Protection

OSD operating specifications document PUREX plutonium/uranium extraction

RECUPLEX recovery of uranium and plutonium by extraction

REDOX reduction-oxidation SST single-shell tank

TWINS Tank Waste Information Network System

WAC Washington Administrative Code

WRPS Washington River Protection Solutions LLC WTP Waste Treatment and Immobilization Plant

WVR waste volume reduction

Units

ft feet gal gallon in. inch

kgal thousand gallons Mgal million gallons

min minute mo month

This page intentionally left blank.

1.0 PURPOSE AND SCOPE

This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report provides data on each of the existing 177 large underground waste storage tanks and smaller miscellaneous underground storage tanks (MUST) and special surveillance facilities, and supplemental information regarding tank surveillance anomalies and ongoing investigations. This report is intended to meet the requirement of DOE O 435.1, *Radioactive Waste Management*, requiring the reporting of tank waste volumes and space utilization for the Hanford Site tank farms.

Throughout this report, individual tanks and tank farms are referred to without the "241" preceding the tank/tank farm designator (e.g., Tank 241-C-102 is referred to as Tank C-102, and 241-A Tank Farm is referred to as A Farm).

1.1 DESCRIPTION OF TABLE 1-1 CHANGES FROM LAST REPORT

Table 1-1 summarizes the DST and SST information available in subsequent detailed tables, and identifies changes in tank and waste status that have occurred during the report period. All table endnotes are included in Section 6.1.

Table 1-1. Waste Tank Summary – July 31, 2016

	Se	ound DSTs		DSTs with Primary Tank Leak ⁽¹⁾			DSTs with Secondary Tank Leak		
	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current
Double-shell	27	27	27	1	1	1	0	0	0
tanks	DST St	torage Cap (Mgal)	acity	Waste	Stored in I (Mgal)	DSTs	Available 1	DST Stora (Mgal)	ge Space
	1 year ago 32.3	1 mo. ago 31.5	Current 31.5	1 year ago 26.1	1 mo. ago 25.6	Current 25.6	1 year ago 3.7	1 mo. ago 3.0	Current 3.0
	Se	ound SSTs		Assum	ed Leaker	SSTs	SSTs wi	th Known Leaks	Active
	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current
	88	88	88	61	61	61	1	1.	1
	SSTs in Level Increase Evaluation ⁽²⁾			SSTs in Level Decrease Evaluation ⁽³⁾			SSTs in Formal Leak Assessment		
Single-shell	1 year ago 0	1 mo. ago	Current 0	1 year ago 0	1 mo. ago	Current 0	1 year ago	1 mo. ago	Current 1
tanks	Total Waste Stored in SSTs (Mgal)			SSTs in Retrieval ⁽⁴⁾			SSTs with Intrusions		
	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current
	28.7	28.6	28.5	3	2	2	15	17	17
		Retrieval Operations Complete ⁽⁵⁾			Retrieval Operations Complete and in Review ⁽⁶⁾				
	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current			
	13	14	14	1	1	1			

Changes in the tank waste summaries listed in Table 1-1 from the previous revision of this report are summarized below.

Best-Basis Inventory revisions of tanks T-102, T-104, T-105, TY-103, U-201 and U-202 reduced the total SST volume by 15 kgals. This resulted in the Total Waste Stored in SSTs system to be calculated at 28,542 kgal, rounded to 28.5 Mgal for purposes of Table 1-1.

Illustrations of the double-shell tank (DST) and single-shell tank (SST) configurations are shown in Figure 1-1 and Figure 1-2, respectively. Figure 1-3 and Figure 1-4 summarize the 200 East Area and 200 West Area tank contents by tank farm.

Surface Level Probe (ENRAF and Manual Tape)
Camera Observation Port

Annulus Pump Pit


Leak Detection Pit

Temperature Thermocouple Assembly

Primary
Steel
Liner
Secondary
Steel
Liner
Reinforced
Concrete
Tank

Figure 1-1. Double-Shell Tank Configuration



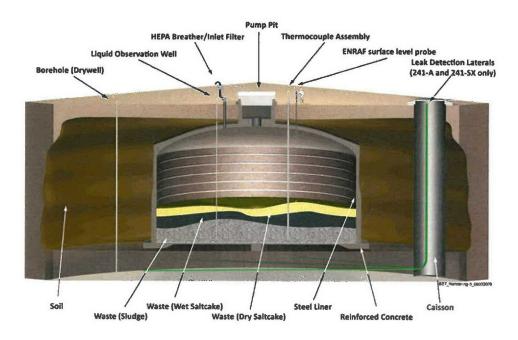

This page intentionally left blank.

LEGEND

Figure 1-3. 200-East Tank Waste Contents



Sludge Saltcake Supernatant Available Space Assumed/Confirmed Leaker


HNF-EP-0182, Rev. 343


M. J. Rodgers

 $\label{thm:linear_log_ers_lo$

Data Derived From Waste Tank Summary Report Dated 7/31/2016

Figure 1-4. 200-West Tank Waste Contents

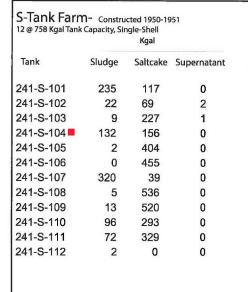


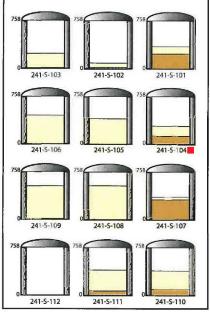

TX-Tank Farr 18 @ 758 Kgal Tank C			1948		758	758	758
		Kgal					
Tank	Sludge	Saltcake	Supernatant		0		0
241-TX-101	73	13	0		241-TX-118	241-TX-117	241-TX-116
241-TX-102	2	211	0		758	758	758
241-TX-103	0	144	0				
241-TX-104	34	33	2				
241-TX-105	11	560	0		0	0	0
241-TX-106	5	337	0		241-TX-115	241-TX-114	241-TX-113
241-TX-107	0	27	0	758	758	758	758
241-TX-108	6	112	0			<u> </u>	
241-TX-109	359	0	0				
241-TX-110	37	425	0	0	0	0	0
241-TX-111	43	316	0	241-TX-112	241-TX-111	241-TX-110	241-TX-109
241-TX-112	0	627	0	758	758	758	758
241-TX-113■	93	545	0				
241-TX-114■	4	518	0			l l	B <mark>rown -</mark> E
241-TX-115■	8	536	0		0	0	
241-TX-116	66	533	0	241-TX-108	241-TX-107	241-TX-106	241-TX-105
241-TX-117■	29	597	0	758	758	758	758
241-TX-118	0	247	0	241-TX-104	241-TX-103	241-TX-102	241-TX-101


SX-Tank Farm- Constructed 1953-1955 15 @ 1,000 Kgal Tank Capacity, Single-Shell

Tank	Sludge	Saltcake	Supernatar
241-SX-101	144	276	0
241-SX-102	55	287	0
241-SX-103	78	431	0
241-SX-104	136	310	0
241-SX-105	63	312	0
241-SX-106	0	399	0
241-SX-107	96	0	0
241-SX-108	74	0	0
241-SX-109	66	175	0
241-SX-110	49	9	0
241-SX-111	97	20	0
241-SX-112	77	0	0
241-SX-113■	22	0	0
241-SX-114	127	31	0
241-SX-115■	4	0	0

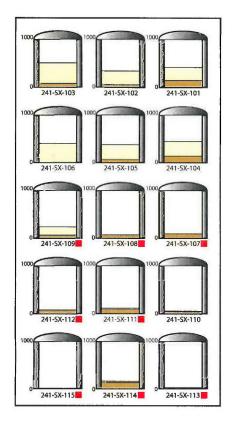

TY-Tank Farm- Constructed 1951-19 6 @ 758 Kgal Tank Capacity, Single-Shell	52
Kgal	

Tank	Sludge	Saltcake	Supernatant
241-TY-101	59	46	0
241-TY-102	0	64	8
241-TY-103	101	51	0
241-TY-104	43	0	1
241-TY-105	231	0	0
241-TY-106	16	0	0

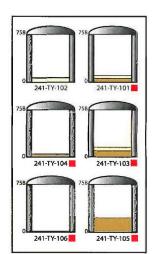

SY-Tank Farm- Constructed 1974-1976 3 @ 1,160 Kgal Tank Capacity, Double-Shell

241-SY-102

241-SY-103


Sludge Saltcake Supernatant 241-SY-101 0 255 862


0

0

357


219

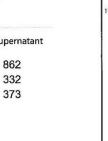

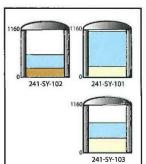


T-Tank Farm- Constructed 1943-1944 12 @ 530 Kgal Tank Capacity, Single-Shell 4 @ 55 Kgal Tank Capacity, Single-Shell

T W JJ Kgai lank Ca	pacity, singi	e-Sitell	
		Kgal	
Tank	Sludge	Saltcake	Supernatant
241-T-101	37	55	2
241-T-102	19	0	11
241-T-103	23	0	3
241-T-104	310	0	0
241-T-105	92	0	0
241-T-106	21	0	0
241-T-107	161	0	5
241-T-108	5	11	0
241-T-109	0	62	0
241-T-110	369	0	1
241-T-111	436	0	0
241-T-112	60	0	7
241-T-201	29	0	2
241-T-202	19	0	0
241-T-203	36	0	0
241-T-204	36	0	0

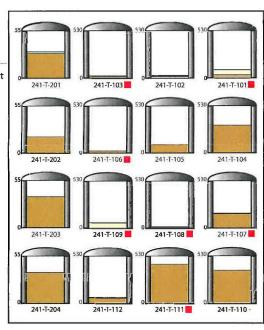



Tank	Sludge	Saltcake	Supernatan
241-U-101	23	0	0
241-U-102	43	283	1
241-U-103	12	404	1
241-U-104	54	0	0
241-U-105	32	321	0
241-U-106	0	168	2
241-U-107	15	279	0
241-U-108	29	404	0
241-U-109	35	366	0
241-U-110	176	0	0
241-U-111	26	193	0
241-U-112	45	0	0
241-U-201	4	0	1
241-U-202	4	0	1
241-U-203	2	0	1
241-U-204	2	0	1

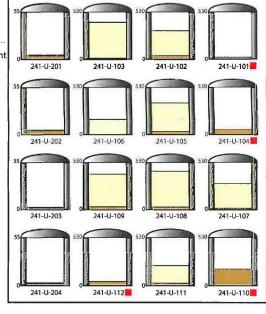

HNF-EP-0182, Rev. 343

1/8 LEGEND

Available Space

■ Assumed/Confirmed Leaker

M. J. Rodgers Data Derived From Waste Tank Summary Report Dated 7/31/2016

2.0 TANK WASTE RETRIEVAL STATUS HIGHLIGHTS

The waste retrieval status of Hanford Tanks is summarized in Table 2-1.

Table 2-1. Tanks in Retrieval Status

Tank (241-)	Status ⁽⁵⁾	Comments	Nominal Volume of Remaining Waste ⁽⁸⁾ (kgal)	Notes (see Section 6.1)
AY-102	Ongoing	Retrieval in progress – retrieval initiated 3/3/2016	40.2	(90)
C-101	Complete	Declared "Retrieved to Limit of First and Second Retrieval Technologies," 9/25/2013	5.5	(9)
C-102	Complete	Declared "Retrieved to Limit of First and Second Retrieval Technologies," 11/30/2015	15.5	(10)
C-103	Complete	Declared "Retrieval Completed," 8/23/2006	2.5	(11)
C-104	Complete	Declared "Retrieval Completed," 8/17/2012	1.8	(12)
C-105	Ongoing	Retrieval in progress – retrieval initiated 6/11/2014	30.4	(13)
C-106	Complete/ In Review	Declared "Retrieval Completed," 12/31/2003	2.8	(14)
C-107	Complete	Declared "Retrieved to Limit of Third Retrieval Technology," 9/30/2014	10.2	(15)
C-108	Complete	Declared "Retrieved to Limit of Modified Sluicing Technology," 3/22/2012	3.3	(16)
C-109	Complete	Declared "Retrieved to Limit of Modified Sluicing Technology," 9/12/2012	1.9	(17)
C-110	Complete	Declared "Retrieval Completed," 10/30/2013	1.8	(18)
C-111	Ongoing	Retrieval in progress – retrieval initiated 9/14/2010	7.7	(19)
C-112	Complete	Declared "Retrieval Completed," 5/29/2014	10.0	(20)
C-201	Complete	Declared "Retrieval Completed," 3/23/2006	0.14	(21)
C-202	Complete	Declared "Retrieval Completed," 8/11/2005	0.15	(22)
C-203	Complete	Declared "Retrieval Completed," 3/24/2005	0.14	(23)
C-204	Complete	Declared "Retrieval Completed," 12/11/2006	0.14	(24)
S-112	Complete	Declared "Retrieval Completed," 3/2/2007	2.4	(25)

This page intentionally left blank.

3.0 DOUBLE-SHELL TANKS MONTHLY SUMMARY TABLES

The DST waste inventory and tank status are summarized in Table 3-1. DST space allocation, inventory, and waste receipts are summarized in Table 3-2.

Table 3-1. Inventory and Status by Tanks – Double-Shell Tanks (2 pages)

		Tank	Total	Available	Was	te volumes	A PERSON	Solids
Tank (241-)	Tank Integrity	Level (in.)	Waste (kgal)	Space (kgal)	Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	Volume Update
AN Farm	Status	130, 53						HEREIG
AN-101	Sound	390	1071	89	287	754	30	4/1/2016
AN-102	Sound	384	1056	104	902	0	154	4/1/2015
AN-103	Sound	350	963	197	472	0	491	6/1/2015
AN-104	Sound	382	1049	111	604	0	445	6/1/2015
AN-105	Sound	408	1123	37	585	0	538	6/1/2015
AN-106	Sound	204	560	600	85	458	17	4/1/2016
AN-107	Sound	390	1071	89	831	0	240	7/1/2015
7 tanks	– Total		6893	1227	3766	1212	1915	
AP Farm S	Status						TENE TO	
AP-101	Sound	449	1235	22	1202	0	33	7/1/2015
AP-102	Sound	203	558	602	418	140	0	4/30/201
AP-103	Sound	410	1126	131	1110	0	16	11/1/201
AP-104	Sound	109	300	957	201	0	99	3/29/201
AP-105	Sound	452	1244	13	1139	0	105	10/1/200
AP-106	Sound	410	1127	33	1127	0	0	10/17/200
AP-107	Sound	451	1239	18	1176	0	63	4/1/2016
AP-108	Sound	452	1243	14	1131	0	112	7/1/2008
8 tanks	– Total		8072	1790	7504	140	428	
AW Farm	Status							
AW-101	Sound	412	1134	26	738	0	396	1/31/2003
AW-102	Sound	226	621	539	569	52	0	10/1/201:
AW-103	Sound	391	1076	84	756	280	40	3/3/2009
AW-104	Sound	382	1049	111	795	97	157	5/1/2015
AW-105	Sound	341	938	222	690	248	0	3/3/2009
AW-106	Sound	410	1126	34	862	0	264	10/1/201
6 tanks	- Total		5944	1016	4410	677	857	

Table 3-1. Inventory and Status by Tanks – Double-Shell Tanks (2 pages)

All volume data obtained from Tank Waste Information Network System (TWINS)

		Tank	Total Available	Was	Waste volumes			
Tank (241-)	Tank Integrity	Level (in.)	Waste (kgal)	Space (kgal)	Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	Solids Volume Update
AY Farm	Status						THE LEW	
AY-101	Sound	183	504	514	399	105	0	10/1/2015
AY-102	Assumed leaker; primary tank	N/Aª	40	0 a	Retrieval	l in progres	SS ⁽⁹⁰⁾	6/30/2016
2 tanks	– Total		544	514	401	143	0	
AZ Farm	Status							
AZ-101	Sound	280	771	247	719	52	0	3/23/2015
AZ-102	Sound	365	1003	15	899	104	0	4/1/2016
2 tanks	– Total		1774	262	1618	156	0	
SY Farm	Status				La Mezione			
SY-101	Sound	406	1117	43	862	0	255	4/1/2008
SY-102	Sound	200	551	609	332	219	0	1/1/2016
SY-103	Sound	266	730	430	373	0	357	6/1/2015
3 tanks	- Total		2398	1082	1567	219	612	

Notes:

- 1 kgal differences are the result of computer rounding.
- Supernatant + sludge (includes liquid) + saltcake (includes liquid) = total waste.
- · Available space volumes include restricted space.
- Tanks AN-103, AN-104, AN-105, AW-101, SY-101, and SY-103 contain retained gas in the saltcake.
- The Solids Volume Update is the date of the most recent BBI estimate or for tanks undergoing retrieval it is the date of the most recent engineering volume estimate.
- ^a AY-102 available space updated to reflect AY-102 status as an assumed leaker. The tank level is Not Applicable (N/A), the surface of the waste in not uniform and there is no primary tank measurement device in service in the tank as of the end of July 31, 2016.

Table 3-2. Double-Shell Tank Space Allocation, Inventory and Waste Receipts

Total DST Capacity (kgal)	Total DST Waste Inve (kgal)	entory	Allocation of Remaining DS' (kgal)	ГSpace
31,516	Inventory on $7/31/2016 =$	25,625	Total DST capacity ^{a,b} =	31,516
	Inventory on $6/30/2016 =$	25,630	Waste inventory =	-25,625
	Change =	-5	Restricted usage space ^c =	-1,609
			Emergency space allocation ^d =	-1,265
			Available space =	3,017

^a Assumes maximum authorized limits per OSD-T-151-00007, Operating Specifications for the Double-Shell Storage Tanks: AN, AW, SY Farm = 422 in., AP Farm = 422 in., except Tanks AP-101, AP-103, AP-104, AP-105, AP-107 and AP-108 = 458 in.; AY and AZ Farms = 370 in, except AY-102 = 40 kgal. Volumes at maximum authorized limit from RPP-CALC-33163, Tank Waste Volume and Level Calculations in Dome Space for 241-AP Tank Farm Up to 460 Inches, and RPP-13019, Determination of Hanford Waste Tank Volumes.

^b Total DST capacity was changed to reflect Tank AY-102 as an assumed leaker

Includes 1,265 kgal emergency space allocation per HNF-3484, *Double-Shell Tank Emergency Pumping Guide*, and emergency WTP returns per 24950-WTP-ICD-MG-019, *ICD 19 – Interface Control Document for Waste Feed*.

Facility Generatio (kgal)	ns	Gains Associated V (kgal)	Vith	Reductions Associated V (kgal)	Vith
Tank farms	0	AZ-301 condensate	6	242-A Evaporator WVR ^j	0
242-A Evaporator ⁱ	0	Instrumentation ^e	1	Instrumentation ^e	0
Tank C-111 retrieval	0	Miscellaneous ^f	2	Miscellaneousf	5
		Thermal expansion ^h	0	Waste evaporation	9
Total =	0	Total =	9	Total =	14

DST Net Waste Inventory Change									
Date	Facility Generation (kgal)	Gains (kgal)	Reductions (kgal)	Net waste Volume Change (kgal)	Total DST Waste Inventory (kgal)				
7/2016	0	9	14	-5	25,625				

- ^e Adjustments due to instrumentation recalibrations and/or instrument flushing.
- f Adjustments for gas retention and release from Waste Group A tanks.
- g A negative value for a retrieval number indicates the net total of retrieval and pumping of supernatant liquid back into the SST for soak of hard-heel solids.
- h Adjustments for thermal expansion of liquids inside tanks.
- ¹ Evaporator gains include additions of pump seal water, slurry, and condensate.
- ¹ 242-A Evaporator WVR is after flush and all water additions.

DST	=	double-shell tank.	WTP	=	Waste Treatment and Immobilization Plant.
SST	=	single-shell tank.	WVR	=	waste volume reduction.

c Restricted space associated with flammable gas Waste Group A (RPP-10006, Methodology and Calculations for the Assignment of Waste Groups for the Large Underground Waste Storage Tanks at the Hanford Site) and tanks controlled for waste feed delivery per feed control list (HNF-SD-WM-OCD-015, Tank Farms Waste Transfer Compatibility Program). These tanks are Tanks AN-102, AN-103, AN-104, AN-105, AN-107, AP-102, AP-105, AW-101, AY-102, and SY-103.

This page intentionally left blank.

4.0 SINGLE-SHELL TANKS MONTHLY SUMMARY TABLES

The SST waste inventory and tank status are summarized in Table 4-1.

Table 4-1. Inventory and Status by Tanks – Single-Shell Tanks (6 pages)

	Tim volume de	ootuillou l	I I I I I I I I I I I I I I I I I I I	1 3 7 7 1	nation Network	TAKELE.	17100	
				Drainable	Waste	Volume	s ⁽²⁶⁾	
Tank (241-)	Tank Integrity	Table 1-1 Tank Status	Total Waste (kgal) ^a	Interstitial Liquid (kgal)	Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	Solids Volume Update ⁽⁸⁹⁾
A Farm S	tatus							
A-101 ⁽²⁷⁾	Sound		320	37	0	3	317	10/1/2006
A-102	Sound	WI	40	9	2	0	38	1/7/2015
A-103 ⁽²⁸⁾	Sound		388	86	10	2	376	1/1/2016
A-104	Assumed leaker		25	0	0	25	0	2/1/2015
A-105	Assumed leaker		37	0	0	37	0	1/1/2016
A-106	Sound		79	9	0	50	29	4/1/2016
6 ta	ınks – Total		889		12	117	760	
AX Farm	Status		*					
AX-101	Sound		358	44	0	3	355	7/1/2015
AX-102	Sound		30	0	0	6	24	10/1/2004
AX-103	Sound		107	22	0	8	99	4/1/2005
AX-104	Sound		5	0	0	5	0	10/1/2015
4 ta	ınks – Total		500		0	22	478	
B Farm S	tatus							
B-101	Assumed leaker		104	20	0	28	76	1/1/2016
B-102	Sound		31	7	4	0	27	1/1/2016
B-103	Assumed leaker		52	10	0	1	51	1/1/2016
B-104	Sound		369	45	0	309	60	1/1/2016
B-105	Assumed leaker		289	20	0	28	261	1/1/2016
B-106	Sound		122	8	1	121	0	10/1/2004
B-107	Assumed leaker		161	23	0	86	75	1/1/2006
B-108	Sound		92	19	0	27	65	1/1/2006
B-109	Sound		122	23	1	50	71	4/1/2015
B-110	Assumed leaker		244	27	0	244	0	1/1/2016
B-111	Assumed leaker		242	23	1	241	0	1/1/2006
B-112	Assumed leaker		33	2	2	14	17	1/1/2016
B-201	Assumed leaker	WI	29	5	0	29	0	7/1/2004
B-202	Sound	WI	29	4	2	27	0	4/1/2015
B-203	Assumed leaker		50	5	1	49	0	4/1/2015
B-204	Assumed leaker		50	5	2	48	0	4/1/2014
16 ta	anks – Total		2,019		14	1,302	703	

Table 4-1. Inventory and Status by Tanks – Single-Shell Tanks (6 pages)

				Drainable	Waste	Volumes	(26)	
Tank (241-)	Tank Integrity	Table 1-1 Tank Status	Total Waste (kgal) ^a	Interstitial Liquid (kgal)	Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	Solids Volume Update ⁽⁸⁹⁾
BX Farm	Status							
BX-101	Assumed leaker	WI	53	4	5	48	0	7/1/2014
BX-102	Assumed leaker		74	0	0	74	0	5/1/2016
BX-103	Sound	WI	77	4	15	62	0	1/1/2014
BX-104	Sound		100	4	3	97	0	10/1/2004
BX-105	Sound		72	4	5	42	25	10/1/2004
BX-106	Sound		38	4	0	10	28	7/1/2006
BX-107	Sound		347	37	0	347	0	4/1/2004
BX-108	Assumed leaker		31	4	0	31	0	4/1/2004
BX-109	Sound		193	25	0	193	0	10/1/2005
BX-110	Assumed leaker	WI	216	35	6	65	145	7/1/2014
BX-111	Assumed leaker		124	6	0	30	94	1/1/2016
BX-112	Sound		164	9	1	163	0	10/1/2004
12 t	anks – Total		1,489		35	1,162	292	
BY Farm	Status				a the officer and the second second second second	1,5,772,77,0,2,2,0,0,0,0,0,0,0,0,0,0,0,0,0,		
BY-101	Sound		365	24	0	37	328	1/1/2016
BY-102	Sound	WI	316	40	0	0	316	1/1/2016
BY-103	Assumed leaker	WI	412	55	0	9	403	1/1/2016
BY-104	Sound		404	44	0	45	359	4/1/2005
BY-105	Assumed leaker		481	47	0	48	433	7/1/2005
BY-106	Assumed leaker		430	37	0	32	398	7/1/2005
BY-107	Assumed leaker		272	42	0	15	257	10/1/2005
BY-108	Assumed leaker		222	33	0	40	182	7/1/2005
BY-109	Sound		287	37	0	24	263	7/1/2005
BY-110	Sound		366	20	0	43	323	7/1/2005
BY-111	Sound		402	14	0	0	402	1/1/2012
BY-112	Sound		286	24	0	2	284	7/1/2005
12 T	anks – Total		4,243		0	295	3,948	

Table 4-1. Inventory and Status by Tanks – Single-Shell Tanks (6 pages)

	All volume da	ata obtained f	rom Tan		nation Network					
				Drainable	Waste	Volume	S ⁽²⁶⁾			
Tank (241-)	Tank Integrity	Table 1-1 Tank Status	Total Waste (kgal) ^a	Interstitial Liquid (kgal)	Supernatant Liquid (kgal)	Sludge (kgal)	Salteake (kgal)	Solids Volume Update ⁽⁸⁹⁾		
C Farm S	tatus									
C-101	Assumed leaker	RC	5.5	Retrieved to litechnologies 9	imit of first and 0/25/2013 ⁽⁹⁾	second re	etrieval	4/23/2015		
C-102	Sound	RC	15.5	Retrieval com	pleted 11/30/20	$015^{(10)}$		3/16/2016		
C-103	Sound	RC	2.5	Retrieval com	pleted 8/23/200)6(11)		8/26/2006		
C-104	Sound	RC	1.8	Retrieval com	Retrieval completed 8/17/2012 ⁽¹²⁾					
C-105 ⁽²⁹⁾	Assumed leaker	R	30.4	Retrieval in pr	rogress(13)			5/1/2016		
C-106	Sound	RCR	2.8	Retrieval com		2/26/2004				
C-107	Sound	RC	10.2	Retrieved to li 9/30/14 ⁽¹⁵⁾	mit of third ret	rieval tech	nnology	3/1/2015		
C-108	Sound	RC	3.3	Retrieved to litechnology 3/2	mit of modified 22/2012 ⁽¹⁶⁾	d sluicing		1/1/2016		
C-109	Sound	RC	1.9	Retrieved to li technology 9/	mit of modified 12/2012 ⁽¹⁷⁾	d sluicing		1/1/2016		
C-110 ⁽³⁰⁾	Sound	RC	1.8	Retrieval com	pleted 10/30/13	3(18)		1/1/2016		
C-111(31)	Sound	R	7.7	Retrieval in pr	cogress(19)			4/1/2016		
C-112	Sound	RC	10.0	Retrieval com	pleted 5/29/201	4(20)		3/4/2015		
C-201	Assumed leaker	RC	0.14	Retrieval com	pleted 3/23/200)6 ⁽²¹⁾		4/27/2006		
C-202	Assumed leaker	RC	0.15	Retrieval com	pleted 8/11/200)5(22)		8/11/2005		
C-203	Assumed leaker	RC	0.14	Retrieval com	pleted 3/24/200)5(23)		3/24/2005		
C-204	Assumed leaker	RC	0.14	Retrieval com	pleted 12/11/20	006(24)		7/17/2007		
16 ta	ınks – Total		137.4		8	128	0			
S Farm St	atus									
S-101	Sound		352	45	0	235	117	7/1/2004		
S-102 (27)(32)	Sound		93	5	2	22	69	10/1/2010		
S-103 ⁽³³⁾	Sound		237	45	1	9	227	4/1/2004		
S-104	Assumed leaker		288	49	0	132	156	10/1/2006		
S-105 ⁽³³⁾	Sound		406	42	0	2	404	1/1/2006		
S-106 ⁽³³⁾	Sound	WI	455	26	0	0	455	4/1/2005		
S-107	Sound		359	42	0	320	39	4/1/2004		
S-108	Sound		541	4	0	5	536	5/1/2016		
S-109	Sound		533	16	0	13	520	1/1/2006		
S-110	Sound		389	30	0	96	293	1/1/2004		
S-111 ⁽²⁷⁾	Sound		401	42	0	72	329	4/1/2016		
S-112	Sound	RC	2		pleted 3/2/2007			4/1/2009		
12 ta	nks – Total		4056		3	906	3,145			

Table 4-1. Inventory and Status by Tanks – Single-Shell Tanks (6 pages)

	多一种"利用"		Fair S	Drainable	Waste	Volumes	(26)	
Tank (241-)	Tank Integrity	Table 1-1 Tank Status	Total Waste (kgal) ^a	Interstitial Liquid (kgal)	Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	Solids Volume Update ⁽⁸⁹⁾
SX Farm S	Status							
SX-101	Sound		420	44	0	144	276	4/1/2005
SX-102	Sound	WI	342	37	0	55	287	4/1/2015
SX-103	Sound		509	40	0	78	431	4/1/2005
SX-104 ⁽³⁴⁾	Sound		446	48	0	136	310	10/1/2006
SX-105	Sound		375	39	0	63	312	4/1/2005
SX-106	Sound	WI	399	37	0	0	399	4/1/2016
SX-107	Assumed leaker		96	7	0	96	0	7/1/2015
SX-108	Assumed leaker		74	0	0	74	0	10/1/2004
SX-109	Assumed leaker		241	0	0	66	175	7/1/2015
SX-110 ⁽³⁵⁾	Sound		58	0	0	49	9	7/1/2015
SX-111	Assumed leaker		117	11	0	97	20	10/1/2015
SX-112	Assumed leaker		77	6	0	77	0	10/1/2015
SX-113	Assumed leaker		22	0	0	22	0	10/1/2015
SX-114	Assumed leaker		158	30	0	127	31	7/1/2015
SX-115	Assumed leaker		4	0	0	4	0	7/1/2015
15 ta	nks – Total		3,338		0	1,088	2,250	
T Farm St	atus							
T-101	Assumed leaker	WI	94	16	2	37	55	6/1/2016
T-102	Sound	FLA	30	3	11	19	0	7/1/2016
T-103	Assumed leaker		26	4	3	23	0	1/1/2016
T-104	Sound		310	31	0	310	0	7/1/2016
T-105	Sound		92	5	0	92	0	7/1/2016
T-106	Assumed leaker		21	0	0	21	0	5/1/2016
T-107	Assumed leaker	WI	166	34	5	161	0	4/1/2016
T-108	Assumed leaker		16	4	0	5	11	10/1 2004
T-109	Assumed leaker		62	11	0	0	62	4/1/2005
T-110	Sound		370	48	1	369	0	4/1/2015
T-111 ⁽⁸⁷⁾	Assumed leaker	AL/WI	436	38	0	436	0	3/10/2015
T-112	Sound		67	4	7	60	0	7/1/2010
T-201	Sound	WI	31	4	2	29	0	5/1/2016
T-202	Sound		19	3	0	19	0	6/1/2016
T-203	Sound		36	5	0	36	0	5/1/2016
T-204	Sound		36	5	0	36	0	5/1/2016
	nks – Total		1,812		31	1,653	128	

Table 4-1. Inventory and Status by Tanks – Single-Shell Tanks (6 pages)

	All volume da	ita obtained f	rom Tanl	Waste Inform	nation Network	System ((WINS)	
				Drainable	Waste	Volumes	(26)	
Tank (241-)	Tank Integrity	Table 1-1 Tank Status	Total Waste (kgal) ^a	Interstitial Liquid (kgal)	Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	Solids Volume Update ⁽⁸⁹⁾
TX Farm	Status							
TX-101	Sound		86	7	0	73	13	10/1/2011
TX-102	Sound		213	27	0	2	211	7/1/2015
TX-103	Sound		144	18	0	0	144	10/1/2015
TX-104	Sound		69	9	2	34	33	10/1/2004
TX-105	Assumed leaker		571	25	0	11	560	10/1/2011
TX-106	Sound		342	37	0	5	337	7/1/2015
TX-107	Assumed leaker		27	7	0	0	27	7/1/2015
TX-108	Sound		118	8	0	6	112	10/1/2015
TX-109	Sound		359	6	0	359	0	10/1/2011
TX-110	Assumed leaker		462	14	0	37	425	10/1/2015
TX-111	Sound		359	10	0	43	316	10/1/2015
TX-112	Sound		627	26	0	0	627	10/1/2015
TX-113	Assumed leaker		638	18	0	93	545	10/1/2005
TX-114	Assumed leaker		522	17	0	4	518	10/1/2015
TX-115	Assumed leaker		544	25	0	8	536	10/1/2015
TX-116	Assumed leaker		599	21	0	66	533	10/1/2004
TX-117	Assumed leaker		626	10	0	29	597	4/1/2011
TX-118	Sound		247	31	0	0	247	10/1/2015
18 ta	ınks – Total		6,553		2	770	5,781	
TY Farm	Status				Walle to			
TY-101	Assumed leaker		105	2	0	59	46	5/1/2016
TY-102	Sound	WI	72	13	8	0	64	7/1/2014
TY-103	Assumed leaker		152	23	0	101	51	7/1/2016
TY-104	Assumed leaker		44	4	1	43	0	4/1/2004
TY-105	Assumed leaker		231	12	0	231	0	4/1/2004
TY-106	Assumed leaker		16	1	0	16	0	10/1/2005
6 tar	ıks – Totals		620		9	450	161	

Table 4-1. Inventory and Status by Tanks – Single-Shell Tanks (6 pages)

All volume data obtained from Tank Waste Information Network System (TWINS)

L-FIR				Drainable	Waste	Volumes	(26)	
Tank (241-)	Tank Integrity	Table 1-1 Tank Status	Total Waste (kgal) ^a	Interstitial Liquid (kgal)	Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	Solids Volume Update ⁽⁸⁹⁾
241-U Tar	ık Farm Status					F 100 - 100	¥1, 1 11	HE STATE
U-101	Assumed leaker		23	4	0	23	0	4/1/2004
U-102	Sound		327	37	1	43	283	4/1/2004
U-103 ⁽²⁷⁾	Sound		417	33	1	12	404	10/1/2004
U-104	Assumed leaker		54	0	0	54	0	4/1/2006
U-105	Sound		353	44	0	32	321	10/1/2004
U-106	Sound		170	36	2	0	168	10/1/2004
U-107	Sound		294	32	0	15	279	4/1/2005
U-108	Sound		433	46	0	29	404	10/1/2004
U-109 ⁽²⁷⁾	Sound		401	47	0	35	366	4/1/2005
U-110	Assumed leaker		176	16	0	176	0	10/1/2005
U-111	Sound	WI	219	31	0	26	193	4/1/2016
U-112	Assumed leaker		45	4	0	45	0	10/1/2004
U-201	Sound		5	1	1	4	0	7/1/2016
U-202	Sound		5	0	1	4	0	7/1/2016
U-203	Sound		3	0	1	2	0	4/1/2005
U-204	Sound		3	0	1	2	0	4/1/2004
16 ta	nks – Totals		2,928		8	502	2,418	

^a 1 kgal differences are the result of computer rounding (e.g., volumes reported as 0 may represent as much as 499 gal of waste).

AL	=	active leak	R	= retrieval (tank in retrieval	=	al)
FLA	=	formal leak assessment	RC	= retrieval complete	=	

= level decrease evaluation. = retrieval complete - in review DE **RCR**

IE = level increase evaluation. WI = water intrusion

4.1 LEAK VOLUME ESTIMATES

In HNF-EP-0182, Waste Tank Summary Report for Month Ending September 30, 2005 (Rev. 210), the leak volume estimates were revised per RPP-23405, Tank Farm Vadose Zone Contamination Volume Estimates. The Washington State Department of Ecology (Ecology) submitted comments on RPP-23405 (Lyon 2005) and until these comments have been resolved, the previous leak volume estimates before Rev. 210 have been reinstated (Schepens 2006a).

Subsequent to issuance of RPP-23405, the U.S. Department of Energy (DOE) and Ecology agreed on a process to update leak volume estimates and the conclusions presented in RPP-23405 (Schepens 2006a). Pursuant to that commitment, RPP-32681, *Process to Assess Tank Farm Leaks in Support of Retrieval and Closure Planning*, established the process to develop estimates of tank farms leak loss inventories. The process is used to assess the source of tank farms leaks when necessary to support tank waste retrieval technology selections, and reassess and update volume estimates and inventories for previously identified tank leaks. If the results suggest a change to the tank's integrity classification, TFC-ENG-CHEM-D-42, "Tank Leak Assessment Process," would be invoked.

Table 4-2 uses HNF-EP-0182, Rev. 209 estimates of leak volumes for SSTs that have known or suspected leaks, unless otherwise noted. Tanks assumed to have leaked but identified via the RPP-32681 process for formal leak assessment were assessed using TFC-ENG-CHEM-D-42 and evaluated as sound. These tanks are listed at the end of the table solely for historical purposes. Endnotes to the table are provided in Section 6.1 and full reference citations are included in Section 6.2. Table 4-3 provides the DST primary tank leak volume estimate.

Table 4-2. Tank Leak Volume Estimates (3 pages)

Tank (241-)	Assumed Leaker ⁽⁴⁵⁾	Estimated Leak Volume (gal) ⁽⁴⁴⁾	Interim Stabilized ⁽⁵¹⁾	Leak Estimate Updated	Notes (see Section 6.1)
A-104	1975	500 to 2,500	9/1978	1983	(56)(85)
A-105	1963	10,000 to 270,000	7/1979	1991	(43)(56)
B-101	1974		3/1981	1989	(48)(85)
B-103	1978	1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 -	2/1985	1989	(48)(85)
B-105	1978		12/1984	1989	(48)(85)
B-107	1980	8,000	3/1985	1986	(49)(85)
B-110	1981	10,000	3/1985	1986	(49)(85)
B-111	1978		6/1985	1989	(48)(85)
B-112	1978	2,000	5/1985	1989	(48)(85)
B-201	1980	1,200	8/1981	1984	(49)(85)
B-203	1983	300	6/1984	1986	(49)(85)
B-204	1984	400	6/1984	1989	(49)(85)
BX-101	1972		9/1978	1989	(48)(85)
BX-102	1971	70,000	11/1978	1986	(85)

Table 4-2. Tank Leak Volume Estimates (3 pages)

Tank (241-)	Assumed Leaker ⁽⁴⁵⁾	Estimated Leak Volume (gal) ⁽⁴⁴⁾	Interim Stabilized ⁽⁵¹⁾	Leak Estimate Updated	Notes (see Section 6.1)
BX-108	1974	2,500	7/1979	1986	(85)
BX-110	1976		8/1985	1989	(48)(85)
BX-111	1984	44	3/1995	1993	(48)(53)(85)
BY-103	1973	<5,000	11/1997	1983	(85)
BY-105	1984		3/2003	1989	(48)(85)
BY-106	1984		N/A	1989	(48)(85)
BY-107	1984	15,100	7/1979	1989	(49)(85)
BY-108	1972	<5,000	2/1985	1983	(85)
C-101	1980	20,000	11/1983	1986	(49)(50)(55)(85)
C-105	2010	<2,000	10/1995	2010	(29) (60)(85)
C-201	1988	550	3/1982	1987	(46)(85)
C-202	1988	450	8/1981	1987	(46)(85)
C-203	1984	400	3/1982	1986	(49)(85)
C-204	1988	350	9/1982	1987	(46)(85)
S-104	1968	24,000	12/1984	1989	(49)(85)
SX-107	1964	<5,000	10/1979	1983	(57)(85)
SX-108	1962	2,400 to 35,000	8/1979	1991	(47)(54)(57)(85)
SX-109	1965	<10,000	5/1981	1992	(47)(54)(57)(85)
SX-111	1974	500 to 2,000	7/1979	1986	(54)(57)(85)
SX-112	1969	30,000	7/1979	1986	(54)(57)(85)
SX-113	1962	15,000	11/1978	1986	(57)(85)
SX-114	1972	_	7/1979	1989	(48)(57)(85)
SX-115	1965	50,000	9/1978	1992	(57)
T-101	1992	7,500	4/1993	1992	(49)(85)
T-103	1974	<1,000	11/1983	1989	(49)(85)
T-106	1973	115,000	8/1981	1986	(49)(85)
T-107	1984		5/1996	1989	(48)(85)
T-108	1974	<1,000	11/1978	1980	(49)
T-109	1974	<1,000	12/1984	1989	(49)(85)
T-111	1979, 1994	<3,500	2/1995	2013	(49)(52)(85)
TX-105	1977		4/1983	1989	(48)(85)
TX-107	1984	2,500	10/1979	1986	(47)(85)
TX-110	1977		04/1983	1989	(48)(85)

Table 4-2. Tank Leak Volume Estimates (3 pages)

Tank (241-)	Assumed Leaker ⁽⁴⁵⁾	Estimated Leak Volume (gal) ⁽⁴⁴⁾	Interim Stabilized ⁽⁵¹⁾	Leak Estimate Updated	Notes (see Section 6.1)
TX-113	1974		4/1983	1989	(48)(85)
TX-114	1974		4/1983	1989	(48)(85)
TX-115	1977	The state of the s	9/1983	1989	(48)(85)
TX-116	1977		4/1983	1989	(48)(85)
TX-117	1977	A Bentamark	3/1983	1989	(48)(85)
TY-101	1973	<1,000	4/1983	1980	(49)(58)
TY-103	1973	3,000	2/1983	1986	(58)(85)
TY-104	1981	1,400	11/1983	1986	(49)(58)(85)
TY-105	1960	35,000	2/1983	1986	(58)(85)
TY-106	1959	20,000	11/1978	1986	(58)(85)
U-101	1959	30,000	9/1979	1986	(85)
U-104	1961	55,000	10/1978	1986	(85)
U-110	1975	5,000 to 8,100	12/1984	1986	(49)(85)
U-112	1980	8,500	9/1979	1986	(49)(85)
61 tanks					
Assumed Leak	ers Assessed per	TFC-ENG-CHEM-D	-42 and Evaluated	as Sound	
A-103	1987	5,500	6/1988	1987	(28)
AX-102	1988	3,000	9/1988	1989	(79)
AX-104	1977	US-Faller	8/1981	1989	(81)
C-110	1984	2,000	5/1995	1989	(30)
C-111	1968	5,500	3/1984	1989	(31)
SX-104	1988	6,000	4/2000	1988	(34)
SX-110	1976	5,500	8/1979	1989	(35)
6 tanks					

Table 4-3. DST Primary Tank Leak Volume Estimates

Tank (241-)	Assumed Leaker	Estimated Leak Volume (gal)	Interim Stabilized	Leak Estimate Updated	Notes (see Section 6.1)
AY-102	2012	1,160	N/A	2016	(1)(59)(85)
1 tank					

4.2 WATER INTRUSION IN SINGLE-SHELL TANKS

Since November 2012, all SST videos (excluding those for retrieval activities) have included evaluation of the tank for water intrusion. Table 4-4 lists those tanks currently identified as having an intrusion. To be included on this list, an SST must meet one of two criteria:

- 1. An intrusion is observed entering the tank during inspection or subsequent video reviews.
- 2. An intrusion is not observed during inspection. Liquid is covering at least part of the waste surface, comparison to past in-tank images shows an increase in visible liquid, and the surface or interstitial liquid level indicate an intrusion is occurring.

Table 4-4. Single-Shell Tanks with Confirmed Water Intrusion

Tank (241-)	Date of Video Inspection ^a	Notes (see Section 6.1)
A-102	1/21/2014	(86)
B-201	2/1/2016	
B-202	1/28/2014	(86)
BX-101	3/11/2013	(86)
BX-103	3/25/2013	(86)
BX-110	2/27/2013	(86)
BY-102	12/28/2012	(86)
BY-103	2/25/2014	(86)
S-106	3/4/2014	(86)
SX-102	11/21/2013	(86)
SX-106	04/15/2013	(86)
T-101	3/10/2014	(86)
T-107	1/4/2016	
T-111	12/30/2013	(86)
T-201	3/26/2014	(86)
TY-102	3/7/2014	(86)
U-111	2/19/2014	(86)

November 2012 and later inspections only, retrieval-related inspections not included. Number of SSTs inspected since November 2012 = 45.

SST = single-shell tank

Table 4-4 lists SSTs identified as having an intrusion in recent years, but the intrusion is not confirmed as currently continuing. To be included in Table 4-4 an SST must meet the following criterion:

1. An intrusion is not observed during inspection. Liquid is covering at least part of the waste surface, comparison to past in-tank images shows an increase in visible liquid, but the surface level or interstitial liquid level are either unavailable or inconclusive as to whether an intrusion is occurring.

Table 4-5. Single-Shell Tanks with Evidence of Recent Water Intrusion

Tank (241-)	Date of Video Inspection ^a	Notes (see Section 6.1)
A-103	1/21/2014	(86)
B-109	1/28/2014	(86)
BY-101	3/11/2013	(86)
S-111	3/25/2013	(86)
TX-108	3/18/2015	(88)

^a November 2012 and later inspections only, retrieval-related inspections not included. Number of SSTs inspected since November 2012 = 45.

SST = single-shell tank

This page intentionally left blank.

5.0 MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES

Table 5-1 and Table 5-2 reflect miscellaneous underground storage tanks and special surveillance facilities in the 200 East and 200 West Areas, respectively, which have traditionally been managed by the tank farms operating contractor, based on WHC-SD-WM-TI-356, *Waste Storage and Leak Detection Criteria*. Assignment of long-term stewardship responsibility has not been determined in some cases.

Table 5-1. 200 East Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (3 pages)

		•	(10)		
Facility	Location	Received Waste From	Nominal Volume of Remaining Waste (kgal ^a)	Volume Date	Notes (see Section 6.1)
204-AR/ 204-AR-TK-1	West of A Farm complex	Liquid waste from 100 Area, 300 Area rail and highway tankers	0.71	3/22/2009	(69)
204-AR/ 204-AR-Sump	West of A Farm complex	Liquid waste from 100 Area, 300 Area rail and highway tankers	No data	-	ario.
209-E-TK-111	209-E Building	Decon catch tank	No data	-	
241-A-302-A	A Farm	A-151 diversion box	0.61	1/13/2015	-
241-A-302-B	A Farm	A-152 diversion box	6.0	12/8/2014	
241-A-350	A Farm	Collects drainage	0.11	6/22/2015	No. 17 -
241-A-417	A Farm	Condensate/drainage from A and AX Farm Tanks 702-A HVAC, A-401 surface condenser seal loops, AZ-154 steam coil	1.2	2/17/2015	-
241-AX-151 catch tank	North of PUREX	PUREX Plant	2.8	8/2/2006	(68)
241-AX-151 (4 diverter tanks)	North of PUREX	PUREX Plant	No data		(68)
241-AX-152 catch tank	AX Farm	AX-152 diversion box, AX-151 diverter	<0.10	12/4/2014	(77)
241-AX-152 (2 diverter tanks)	AX Farm	AX-152 diversion box	No data		(77)
241-AZ-151	AZ Farm	AZ-702 condensate	2,3	12/10/2014	-
241-AZ-154	AZ Farm	AZ-101 and AZ-102 steam condensate	<0.10	7/31/2008	
241-AZ-301	AZ Farm	AZ-702 condensate	N/A		(71)
241-B-301-B	B Farm	B-151, B-152, B-153, B-252 diversion box	0.54	4/24/1985	1-2
241-B-302-B	B Farm	B-154 diversion box	5.0	5/10/1985	TO MICH.

Table 5-1. 200 East Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (3 pages)

Facility	Location	Received Waste From	Nominal Volume of Remaining Waste (kgal ^a)	Volume Date	Notes (see Section 6.1)
241-BX-302-A	BX Farm	BX-152, BX-153, BXR-152, BYR-152 diversion box	0.83	3/14/1984	
241-BX-302-B	BX Farm	BX-154 diversion box	1.0	5/8/1985	-
241-BX-302-C	BX Farm	BX-155 diversion box	0.84	4/11/1985	
241-BY-ITS2-TK 1	BY Farm	Vapor condenser	No data	-	
241-BY-ITS2-TK 2	BY Farm	Heater flush tank	0.78	8/24/2006	
241-C-301-C	C Farm	C-151, C-152, C-153, C-252 diversion box	10.5	5/31/1985	-
241-ER-311	Southwest of B Plant	ER-151, ER-152 diversion box	<0.10	12/23/2014	(63)
241-ER-311A	Southwest of B Plant	ER-151 diversion box	Empty	-	
244-A-TK	A Farm complex	DCRT (receives from several locations)	4.9	10/23/2014	
244-A-Sump	A Farm complex	DCRT (receives from several locations)	<0.10	10/23/2014	
244-AR Vault/ TK-244-AR-001	A Farm complex	A and AX Farms	0.66	10/23/2014	(72)
244-AR Vault/ Sump-AR-001	A Farm complex	Process jumper connection leaks or cell decon washdowns	<0.10	10/23/2014	(72)
244-AR Vault/ TK-244-AR-002	A Farm complex	A and AX Farms	2.1	2/18/2015	(72)
244-AR Vault/ Sump-AR-002	A Farm complex	Process jumper connection leaks or cell decon washdowns	<0.10	10/23/2014	(72)
244-AR Vault/ TK-244-AR-003	A Farm complex	A and AX Farms	<0.10	10/23/2014	(72)
244-AR Vault/ Sump-AR-003	A Farm complex	Process jumper connection leaks or cell decon washdowns	5.8	2/18/2014	(72)
244-AR Vault/ TK-244-AR-004	A Farm complex	A and AX Farms	<0.10	10/30/2014	(72)
244-BX-TK	BX Farm complex	B, BX, and BY Farm saltwells	11.0	3/31/2015	
244-BX-Sump	BX Farm complex	B, BX, and BY Farm saltwells	<0.10	3/31/2015	
244-BXR Vault/ TK-BXR-001	BX Farm	BX Farm and diversion boxes	4.1	11/1984	-
244-BXR Vault/ Sump-BXR-001	BX Farm	Process jumper connection leaks or cell decon washdowns	<0.10	4/1984	
244-BXR Vault/ TK-BXR-002	BX Farm	BX Farm and diversion boxes	1.1	2/20/1985	

Table 5-1. 200 East Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (3 pages)

Facility	Location	Received Waste From	Nominal Volume of Remaining Waste (kgal ^a)	Volume Date	Notes (see Section 6.1)
244-BXR Vault/ Sump-BXR-002	BX Farm	Process jumper connection leaks or cell decon washdowns	<0.10	2/1985	
244-BXR Vault/ TK-BXR-003	BX Farm	BX Farm and diversion boxes	0.79	2/18/1985	-
244-BXR Vault/ Sump-BXR-003	BX Farm	Process jumper connection leaks or cell decon washdowns	7.2	2/18/1985	
244-BXR Vault/ TK-BXR-011	BX Farm	BX Farm and diversion boxes	4.0	4/1984	
244-BXR Vault/ Sump-BXR-011	BX Farm	Process jumper connection leaks or cell decon washdowns	7.6	1/24/1985	
244-CR Vault/ TK-CR-001	C Farm	B, BX, BY, C Farm sludge slurry	4.3	6/8/2015	(70)
244-CR Vault/ Sump-CR-001	C Farm	Process jumper connection leaks or cell decon washdowns	< 0.10	3/3/2010	(70)
244-CR Vault/ TK-CR-002	C Farm	244-CR Vault Tank CR-001	0.75	11/29/2004	(70)
244-CR Vault/ Sump-CR-002	C Farm	Process jumper connection leaks or cell decon washdowns	<0.10	3/09/2010	(70)
244-CR Vault/ TK-CR-003	C Farm	Former C Farm saltwell receiver tank	2.3	12/23/2014	(70)
244-CR Vault/ Sump-CR-003	C Farm	Process jumper connection leaks or cell decon washdowns	<0.10	3/10/2010	(70)
244-CR Vault/ TK-CR-011	C Farm	244-CR Vault Tanks CR-002 and CR-003	4.0	11/30/2004	(70)
244-CR Vault/ Sump-CR-011	C Farm	Process jumper connection leaks or cell decon washdowns	<0.10	2/25/2010	(70)

^a Nominal volume of remaining waste is in kgal, unless noted otherwise.

DCRT = double-contained receiver tank.

PUREX = plutonium/uranium extraction.

HVAC = heating, ventilation, and air conditioning.

Table 5-2. 200 West Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (3 pages)

Facility	Location	Received Waste From	Nominal Volume of Remaining Waste (kgal ^a)	Volume Date	Notes (see Section 6.1)
213W-TK-1	East of 213-W Compactor Facility	Water retention tank	1.6	3/19/1999	
231-W-151-001	North of Z Plant	231-Z floor drains	1.4	8/15/1974	\-\-\-\-\-\-\-\-\-\-\-\-\-\-\-\-\-\-\-
231-W-151-002	North of Z Plant	231-Z floor drains	0.96	8/15/1974	-
240-S-302	North of REDOX Plant	240-S-151 diversion box	1.7	10/1/2014	(64)
241-E/W-151 Vent Station Catch Tank	South of 609-A	Cross-site transfer lines/encasement	0.55	4/15/2015	(66)
241-S-302A	S Farm	S-151 diversion box	0.30	3/19/2001	(82)
241-S-302B	SX Farm	S encasements	< 0.10	4/1984	
241-S-304	S Farm	S-151 diversion box	0.13	10/27/2015	an Orași
241-SX-302	SX Farm	SX-151 diversion box, SX-152 transfer box	1.4	11/1984	
241-T-301	T Farm	T-151, T-152, T-153, T-252 diversion box	22.0	7/3/1985	
241-TX-302A	TX Farm	TX-153 diversion box	2.5	8/1984	
241-TX-302B	East of TX Farm	TX-155 diversion box	1.7	1/13/2015	(83)
241-TX-302-B(R)	East of TX Farm	TX-155 diversion box	No data	-	(83)
241-TX-302C	T Plant	TX-154 diversion box	0.36	5/21/2015	
241-TX-302-X-B	TX Farm	TX encasements	0.34	8/1984	-
241-TY-302A	TY Farm	TY-153 diversion box	0.46	6/25/1985	
241-TY-302B	TY Farm	TY encasements	< 0.10	8/1984	
241-U-301B	U Farm	U-151, U-152, U-153, U-252 diversion box	1.5	1/5/2015	-
241-UX-302A	U Plant	UX-154 diversion box	0.85	5/18/2015	(65)
241-Z-8 (216-Z-8)	East of Z Plant	RECUPLEX	0,50	10/19/1974	
242-S TK C-100	242-S Evaporator	242-S Evaporator process condensate	8.0		-
242-T-135	T Evaporator	T Evaporator	No data		(76)
242-TA-R1	T Evaporator	Z Plant	No data		(75)
242-TA-Sump	T Evaporator	Z Plant	< 0.10	9/24/2010	(75)

Table 5-2. 200 West Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (3 pages)

		Special Sur vemance	weineres (c page	-	
Facility	Location	Received Waste From	Nominal Volume of Remaining Waste (kgal ^a)	Volume Date	Notes (see Section 6.1)
243-S-TK-1	Northwest of S Farm	Personnel decontamination facility	No data		
244-S-TK	S Farm	From SSTs for transfer to Tank SY-102	3.6	2/4/2015	K=/ 1= == X
244-S-Sump	S Farm	From SSTs for transfer to Tank SY-102	0.10	3/17/2015	
244-TX-TK	TX Farm	Z Plant	6.9 gal	3/3/2015	<u> </u>
244-TX-Sump	TX Farm	Z Plant	<0.10 gal	6/13/2011	
244-TXR Vault/ TK-TXR-001	TX Farm	Transfer lines, TXR-151 diversion box	0.47	10/1984	i den
244-TXR Vault/ Sump-TXR-001	TX Farm	Process jumper connection leaks or cell decon washdowns	<0.10	10/1984	-
244-TXR Vault/ TK-TXR-002	TX Farm	Transfer lines	1.9	10/1984	-
244-TXR Vault/ Sump-TXR-002	TX Farm	Process jumper connection leaks or cell decon washdowns	0.10	10/1984	-
244-TXR Vault/ TK-TXR-003	TX Farm	Transfer lines	5.3	10/1984	7
244-TXR Vault/ Sump-TXR-003	TX Farm	Process jumper connection leaks or cell decon washdowns	<0.10	10/1984	-
244-U-TK	U Farm	U Farm saltwell liquids	1.9	11/3/2010	-
244-U-Sump	U Farm	Process jumper connection leaks or cell decon washdowns	No data	-	(84)
244-UR Vault/ TK-UR-001	U Farm	U Farm	0.42	7/1984	
244-UR Vault/ Sump-UR-001	U Farm	Process jumper connection leaks or cell decontamination washdowns	1.2	6/26/1984	-
244-UR Vault/ TK-UR-002	U Farm	U Farm	1.5	7/11/1984	-
244-UR Vault/ Sump-UR-002	U Farm	Process jumper connection leaks or cell decontamination washdowns	<0.10	7/8/1984	-

Table 5-2. 200 West Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (3 pages)

Facility	Location	Received Waste From	Nominal Volume of Remaining Waste (kgal ^a)	Volume Date	Notes (see Section 6.1)
244-UR Vault/ TK-UR-003	U Farm	U Farm	0.60	7/1984	-
244-UR Vault/ Sump-UR-003	U Farm	Process jumper connection leaks or cell decontamination washdowns	3.4	6/21/1984	-
244-UR Vault/ 244-UR-004	U Farm	U Farm	No data	-1 - -	(74)

^a Nominal volume of remaining waste is in kgal, unless noted otherwise.

6.0 ENDNOTES AND REFERENCES

6.1 REPORT ENDNOTES

Table 6-1 includes all endnotes for the tables found in Sections 1.0 through 5.0 of this report. When an endnote is referenced multiple times, the location column shows each table referencing the endnote.

Table 6-1. Waste Tank Summary Report Endnotes (8 pages)

	Table 6 1. Waste Tank Summary Report Enditotes (6 pages)	
No.a	Comment/Reference	Location
(1)	RPP-ASMT-53793, <i>Tank 241-AY-102 Leak Assessment Report</i> , states that Tank AY-102 was declared an "Assumed Leaker – Primary Tank" on October 19, 2012, due to the results of a leak assessment performed on discovery of waste material in the tank's annulus space. The ORP was notified of the intention to change the tank's leak integrity classification (Clark 2012).	Table 1-1, Table 4-2
(2)	SSTs in level increase evaluation – Tanks being evaluated for waste level increase per RPP-PLAN-55112, September 2012 Single-Shell Tank Waste Level Increase Evaluation Plan.	Table 1-1
(3)	SSTs in level decrease evaluation – Tanks being evaluated for waste level decrease per RPP-PLAN-55113, <i>March 2013 Single-Shell Tank Waste Level Decrease Evaluation Plan</i> .	Table 1-1
(4)	SSTs in retrieval – Tanks with active bulk or heel retrieval operations in progress or awaiting heel retrieval (e.g., Tanks C-105, C-111).	Table 1-1
(5)	Retrieval operations complete – Tanks have active retrieval operations completed (e.g., Tanks C-101, C-102, C-103, C-104, C-107, C-108, C-109, C-110, C-112, C-201, C-202, C-203, C-204, and S-112); retrieval data report and/or retrieval completion certification have been provided to ORP for review and submittal to Ecology.	Table 1-1 Table 2-1
	Letter of Completion for Retrieval Data Report (from ORP to Ecology) for the following tanks:	
	 Tank C-101 (letter 15-TF-0099, dated September 24, 2015 [Smith 2015b]) 	
	 Tank C-103 (letter 07-TPD-026, dated May 21, 2007 [Olinger 2007a]) 	
	* Tonk C 104 (letter 14 TE 0012 deted February 19 2014 (Smith 2014))	

- Tank C-104 (letter 14-TF-0013, dated February 18, 2014 [Smith 2014e])
- Tank C-107 (letter 15-TF-0086, dated September 14, 2015 [Smith 2015d])
- Tank C-108 (letter 13-TF-0120, dated November 27, 2013 [Smith 2013b])
- Tank C-109 (letter 14-TF-0020, dated March 13, 2014 [Smith 2014f])
- Tank C-110 (letter 14-TF-0086, dated August 6, 2014 [Smith 2014g])
- Tank C-112 (letter 15-TF-0098, dated September 30, 2015 [Smith 2015c])
- Tank C-201 (letter 06-TPD-071, dated November 2, 2006 [Schepens 2006b])
- Tank C-202 (letter 06-TPD-051, dated July 31, 2006 [Schepens 2006c])
- Tank C-203 (letter 06-TPD-005, dated January 18, 2006 [Schepens 2006d])
- Tank C-204 (letter 07-TPD-043, dated August 9, 2007 [Olinger 2007b])
- Tank S-112 (letter 07-TPD-066, dated December 21, 2007 [Olinger 2007c]).

Retrieval completion certifications provided by ORP to Ecology for the following tanks:

- Tank C-101 (letter 14-TF-0113, dated September 24, 2014 [Smith 2014b])
- Tank C-102 (letter 15-TF-0116, dated November 30, 2015 [Smith 2015a])
- Tank C-104 (letter 13-TF-0018, dated March 21, 2013 [Fletcher 2013a])
- Tank C-107 (letter 14-TF-0114, dated September 30, 2014 [Smith 2014c])
- Tank C-108 (letter 13-TF-0025, dated May 1, 2013 [Fletcher 2013b])
- Tank C-109 (letter 13-TF-0037, dated June 4, 2013 [Smith 2013a])
- Tank C-110 (letter 14-TF-0007, dated January 29, 2014 [Smith 2014a]).
- Tank C-112 (letter 14-TF-0115, dated September 30, 2014 [Smith 2014d]).

Table 6-1. Waste Tank Summary Report Endnotes (8 pages)

No.a	Comment/Reference	Location
(6)	Retrieval operations complete and in review – Tank(s) have active retrieval operations completed (e.g., Tanks C-106); report or practicability evaluation is pending approval; or evaluation has been accepted, but final completion letter or certification submittal is pending.	Table 1-1
(8)	Nominal volume of waste inventory is the best estimate of residual volume. Retrieval data reports also provide 95 percent upper confidence level volume as the bounding estimate of remaining waste.	Table 2-1
(9)	Tank C-101 nominal waste volume – Total waste 4,995 gal (RPP-CALC-56434, Post-Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-101) revised to 5.5 kgal (RPP-RPT-54440, Derivation of Best-Basis Inventory for Tank 241-C-101 as of April 23, 2015)	Table 2-1, Table 4-1
(10)	Tank C-102 nominal waste volume estimate – Total waste 15.5 kgal (RPP-RPT-57458, Derivation of Best-Basis Inventory for tank 241-C-102 as of March 16, 2016)	Table 2-1, Table 4-1
(11)	Tank C-103 nominal waste volume Total waste 2,529 gal, sludge 2,282 gal, supernatant 247 gal (RPP-RPT-33060, Retrieval Data Report for Single-Shell Tank 241-C-103).	Table 2-1, Table 4-1
(12)	Tank C-104 nominal waste volume – Total waste 1,8 kgal of sludge (RPP-RPT-46616, Derivation of Best-Basis Inventory for Tank 241-C-104 as of January 1, 2016).	Table 2-1, Table 4-1
(13)	Tank C-105 nominal waste volume estimate – Total waste 30,375 gal remaining. (RPP-RPT-58071, Derivation of Best-Basis Inventory for Tank 241-C-105 as of May 1, 2016 and RPP-CALC-60933, Residual Waste Volume of Tank 241-C-105 Following Operations of MARS-V System.).	Table 2-1, Table 4-1
(14)	Tank C-106 nominal waste volume – Total waste 2,771 gal, sludge 2,686 gal, supernatant 85 gal (RPP-20577, Stage II Retrieval Data Report for Single-Shell Tank 241-C-106).	Table 2-1, Table 4-1
(15)	Tank C-107 waste volume estimate – Total waste 10 kgal of sludge (RPP-RPT-48745, Rev. 9, Derivation of Best-Basis Inventory for Tank 241-C-107 as of March 1, 2015).	Table 2-1, Table 4-1
(16)	Tank C-108 nominal waste volume – Total waste 3.3 kgal sludge (RPP-RPT-45147, <i>Derivation of Best-Basis Inventory for Tank 241-C-108 as of January 1, 2016</i>).	Table 2-1, Table 4-1
(17)	Tank C-109 nominal waste volume – Total waste 1.9 kgal (RPP-RPT-51343, <i>Derivation of Best-Basis Inventory for Tank 241-C-109 as of January 1, 2016</i>).	Table 2-1, Table 4-1
(18)	Tank C-110 nominal waste volume – Total waste 1,776 gal (RPP-CALC-56399, Post-Hard Heel Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-110).	Table 2-1, Table 4-1
(19)	Tank C-111 volume estimate – Total waste 7.7 kgal (RPP-RPT-48459, Derivation of Best-Basis Inventory for Tank 241-C-111 as of April 1, 2016.	Table 2-1, Table 4-1
(20)	Tank C-112 waste volume estimate – Total waste 12,700 gal (RPP-CALC-56856, <i>Estimated Waste Volume Remaining in Single-Shell Tank 241-C-112 after Hard Heel Retrieval</i>); revised to 10,000 gal (RPP-RPT-52516, <i>Derivation of Best-Basis Inventory For Tank 241-C-112 as of March 3, 2015</i>).	Table 2-1, Table 4-1
(21)	Tank C-201 nominal waste volume – Total waste 144 gal, sludge 142 gal, supernatant 2 gal (RPP-29441, Post-Retrieval Waste Volume Determination for Single-Shell Tank 241-C-201).	Table 2-1, Table 4-1
(22)	Tank C-202 nominal waste volume – Total waste 147 gal, sludge 145 gal, supernatant 2 gal (RPP-RPT-29095, <i>Retrieval Data Report for Single-Shell Tank 241-C-202</i>).	Table 2-1, Table 4-1
(23)	Tank C-203 nominal waste volume – Total waste 139 gal, sludge 126 gal, supernatant 13 gal (RPP-RPT-26475, Retrieval Data Report for Single-Shell Tank 241-C-203).	Table 2-1, Table 4-1
(24)	Tank C-204 nominal waste volume – Total waste 137 gal, sludge 134 gal, supernatant 3 gal (RPP-RPT-34062, <i>Retrieval Data Report for Single-Shell Tank 241-C-204</i>).	Table 2-1, Table 4-1

Table 6-1. Waste Tank Summary Report Endnotes (8 pages)

No.a	Comment/Reference	Location
(25)	Tank S-112 nominal waste volume – Total waste 2,387 gal, sludge/saltcake 2,263 gal, supernatant 124 gal (RRP-RPT-35112, Retrieval Data Report for Single-Shell Tank 241-S-112).	Table 2-1, Table 4-1
(26)	For some tanks, a volume difference exists between estimates published in HNF-SD-RE-TI-178, Single-Shell Tank Interim Stabilization Record, and later TWINS estimates. TWINS estimates are reported in Table 4-1.	Table 4-1
(27)	Tank A-101 contains retained gas in saltcake; Tanks S-102, S-111, U-103, and U-109 contain retained gas in saltcake and sludge.	Table 4-1
(28)	Status of Tank A-103 changed from "assumed leaker" to "sound" per RPP-ASMT-42278, <i>Tank 241-A-103 Leak Assessment Report</i> .	Table 4-1, Table 4-2
(29)	Status of Tank C-105 changed from "sound" to "assumed leaker" per RPP-ASMT-46452, Tank 241-C-105 Leak Assessment Completion Report.	Table 4-1, Table 4-2
(30)	Status of Tank C-110 changed from "assumed leaker" to "sound" per RPP-ASMT-38219, <i>Tank 241-C-110 Leak Assessment Report</i> .	Table 4-1, Table 4-2
(31)	Status of Tank C-111 changed from "assumed leaker" to "sound" per RPP-ASMT-39155, Tank 241-C-111 Leak Assessment Report.	Table 4-1, Table 4-2
(32)	Retrieval operations began in Tank S-102 on December 16, 2004, and were suspended in July 2007. Actions were subsequently taken to reduce the remaining liquid volume to below interim stabilization criteria. A letter was submitted to DOE on June 1, 2010, that stated Tank S-102 again met interim stabilization criteria (Sax 2010).	Table 4-1
(33)	The Hanford Federal Facility Agreement and Consent Order (signed August 2004) modified Milestone M-45-00C (Change Order M-45-04-01) changing the regulatory requirements for retrieval of waste in Tanks S-103, S-105, and S-106 (Ecology et al 1989). "Retrieval" status in these tanks is thereby rescinded.	Table 4-1
(34)	Status of Tank SX-104 changed from "assumed leaker" to "sound" per RPP-ASMT-48143, <i>Tank 241-SX-104 Leak Assessment Completion Report</i> .	Table 4-1, Table 4-2
(35)	Status of Tank SX-110 changed from "assumed leaker" to "sound" per RPP-ASMT-47140, <i>Tank 241-SX-110 Leak Assessment Report</i> .	Table 4-1, Table 4-2

Table 6-1. Waste Tank Summary Report Endnotes (8 pages)

No.a	Comm	nent/Reference		Location		
(43)	 WHC-MR-0264, Tank 241-A-105 Leak Assessment, estimated that 610 kgal of cooling water was added to Tank A-105 from November 1970 to December 1978 to aid in evaporative cooling. In accordance with Washington Administrative Code (WAC) 173-303-070 (2)(a)(ii), any of this added cooling water that has subsequently leaked from the tank must be classified as a waste and should be included in the total leak volume. In August 1991, the leak volume estimate for this tank was updated in accordance with the WAC regulations. Previous estimates excluded the cooling water leaks from the total leak volume estimates because the waste content (concentration) in the cooling water that leaked should be much less than the original liquid waste in the tank (the sludge is relatively insoluble). The total leak volume estimate in this report (10 to 277 kgal) is based on the following: WHC-MR-0264 estimates 5 to 15 kgal for the initial leak prior to August 1968. WHC-MR-0264 also estimates 5 to 30 kgal for the leak while the tank was being sluiced from August 1968 to November 1970. WHC-MR-0264 estimates that 610 kgal of cooling water was added to the tank from November 1970 to December 1978, and leakage was estimated to be small during this period. This reference states "Sufficient heat was generated in the tank to evaporate most, and perhaps nearly all, of this water." This results in a low estimate of zero gallons leakage from November 1970 to December 1978. WHC-EP-0410, Tank 241-A-105 Evaporation Estimate 1970 Through 1978, estimates that 378 to 410 kgal evaporated out of the tank from November 1970 to December 1978. Subtracting the minimum evaporation estimate from the cooling water added estimate provides a range from 0 to 232 kgal of cooling water leakage from November 1970 to December 1978. 					
	Time period	Low estimate	High estimate			
	Prior to August 1968	5,000	15,000			
	August 1968 to November 1970	5,000	30,000			
	November 1970 to December 1978	0	232,000			
	Totals	10,000	277,000			
(44)	Tank leak volume estimates are being update review of tanks for retrieval/closure consider include (with some exceptions). (a) cooling/subsequent leaks, (c) leaks inside the tank fa pipeline leaks, leaks at the joint for the overfunks, diversion boxes, encasements, etc.	ration. The tank leak volume raw water leaks, (b) intrusion rm but not through the tank l	e estimates do not is (rain infiltration) and iner (surface leaks,	Table 4-2		
(45)	In many cases, a leak was suspected long be SD-WM-SAR-006, Single-Shell Tank Isolati			Table 4-2		

- SD-WM-SAR-006, Single-Shell Tank Isolation Safety Analysis Report, shows that Tank U-104 was suspected of leaking in 1956. The leak was confirmed in 1961. This report lists the "assumed leaker" date of 1961. Using present standards, Tank U-104 would have been declared an assumed leaker in 1956. In 1984, the criteria designations of "suspected leaker," "questionable integrity," "confirmed leaker," "declared leaker," and "borderline and dormant" were merged into one category now reported as "assumed leaker." Catlin (1980) describes when, how long, and how fast some of the tanks leaked.
- (46) The leak volume estimate date for these tanks is before the declared leaker date because the tank Table 4-2 was in a suspected leaker or questionable integrity status; however, a leak volume had been estimated prior to the tank being reclassified.
- (47) The increasing radiation levels in drywells and laterals associated with these three tanks could be Table 4-2 indicating a continuing leak or movement of existing radionuclides in the soil. There is no conclusive way to confirm these observations. (There are currently no functioning laterals and no plan to prepare them for use).

Table 6-1. Waste Tank Summary Report Endnotes (8 pages)

No.a	Comment/Reference	Location
(48)	Methods were used to estimate the leak volumes from these 19 tanks based on the assumption that their cumulative leakage is approximately the same as for 18 of the 24 tanks identified in Baumhardt (1989) and Jensen/Merril (1989). The total leak volume estimate for these tanks is 150 kgal (rounded to the nearest kgal), for an average of approximately 8 kgal for each of 19 tanks.	Table 4-2
(49)	Leak volume estimate is based solely on observed liquid level decreases in these tanks. This is considered to be the most accurate method for estimating leak volumes.	Table 4-2
(50)	Tank C-101 experienced a liquid level decrease in the late 1960s and was taken out of service and pumped to a minimum heel in December 1969. In 1970, the tank was classified as a "questionable integrity" tank. Liquid level data show decreases in level throughout the 1970s, and the tank was saltwell pumped during the 1970s, ending in April 1979. The tank was reclassified as a "confirmed leaker" in January 1980 (WHC-MR-0132, A History of the 200 Area Tank Farms, and WHC-SD-EN-TI-185, Assessment of Unsaturated Zone Radionuclide Contamination Around Single Shell Tanks 241-C-105 and 241-C-106). WHC-SD-EN-TI-185 provides information on the potential for leaks from other C Farm tanks (specifically Tanks C-102, C-103, and C-109).	Table 4-2
(51)	These dates indicate when the tanks were declared to be interim stabilized. In some cases, the official interim stabilization documents were issued at a later date. Also, in some cases, the field work associated with interim stabilization was completed at an earlier date.	Table 4-2
(52)	Tank T-111 was declared an "assumed re-leaker" on February 28, 1994, due to a decreasing trend in surface level measurement. This tank was pumped, and interim stabilization was completed on February 22, 1995. RPP-RPT-54964, <i>Evaluation of Tank 241-T-111 Level Data and In-Tank Video Inspection</i> , estimated that from 1995 to January 1, 2014, Tank T-111 leaked approximately 2,500 gal. The value reported in Table 4-2 sums the <1,000 gal reported in 1994, with the approximately 2,500 gal reported in 2013.	Table 4-2
(53)	Tank BX-111 was declared an "assumed re-leaker" in April 1993. Preparations for pumping were delayed following an administrative hold placed on all tank farm operations in August 1993. Pumping resumed and the tank was declared interim stabilized on March 15, 1995.	Table 4-2
(54)	The leak volume and curie release estimates on Tanks SX-108, SX-109, SX-111, and SX-112 have been reevaluated using a historical leak model (HNF-3233, Re-Analysis of SX Farm Leak Histories with the Historical Leak Model Rev. 1 [HLMr]). In general, the model estimates are much higher than the values listed in Table 4-2, both for volume and curies released. The values listed in the table do not reflect this revised estimate because, "In particular, it is worth emphasizing that this report was never meant to be a definitive update for the leak baseline at the Hanford Site. It was rather meant to be an attempt to view the issue of leak inventories with a new and different methodology" (HNF-3233).	Table 4-2
(55)	Leak from Tank C-101 was re-assessed in RPP-ENV-33418, <i>Hanford C-Farm Leak Assessments Report</i> . Revised leak volumes presented in the report have not yet been adopted in Table 4-2.	Table 4-2
(56)	Leaks from Tanks A-104 and A-105 were re-assessed in RPP-ENV-37956, <i>Hanford 241-A/AX Farm Leak Inventory Assessment Report</i> . Revised leak volumes presented in the report have not yet been adopted in Table 4-2.	Table 4-2
(57)	Leaks from Tanks SX-107, SX-108, SX-109, SX-111, SX-112, SX-113, SX-114, and SX-115 were re-assessed in RPP-ENV-39658, <i>Hanford SX-Farm Leak Assessments Report</i> . Revised leak volumes presented in the report have not yet been adopted in Table 4-2.	Table 4-2

Table 6-1. Waste Tank Summary Report Endnotes (8 pages)

No.a	Comment/Reference	Location
(58)	Leaks from Tanks TY-101, TY-103, TY-104, TY-105, and TY-106 were re-assessed in RPP-RPT-42296, Hanford TY-Farm Leak Assessments Report. Revised leak volumes presented in the report have not been adopted pending completion of a formal leak assessment of Tank TY-101 using TFC-ENG-CHEM-D-42.	Table 4-2
(59)	Previous estimates (RPP-ASMT-53793) states that at the time of publication (11/7/12), the leak volume was estimated to be between 190 to 520 gal. A significant portion of the liquid had evaporated, leaving about 20 to 50 gal of drying waste in the tank annulus space. As of 6/30/2016 the estimated annulus volume was 1,015 gallons (RPP-RPT-59556, <i>Tank 241-AY-102 Monthly Monitoring Report June 2016</i>).	Table 4-2
(60)	A reevaluation of the Tank C-105 leak integrity using TFC-ENG-CHEM-D-42 was completed in May 2010, concluding that a leak from the tank could not be ruled out by the evidence from recently completed Direct Push C7469 and other available data, and recommending that the leak integrity status be revised to "assumed leaker." The estimated leak volume was <2,000 gal (RPP-ASMT-46452).	Table 4-2
(63)	A leak assessment was performed because of the 0.5-in. liquid level decrease between early October 2005 and January 31, 2006. The leak assessment, issued on March 17, 2006, concluded that a tank leak was the most likely explanation for the level trend (RPP-RPT-29163, <i>Tank 241-ER-311 Leak Assessment Report</i>).	Table 5-1
	The solids volume in the tank is not known. Sample activities conducted during November 1999 concluded that there were approximately 7 to 9 in. of solids beneath the east riser and no solids beneath the west riser (HNF-5985, <i>ER-311 Flammable Gas Response and Findings</i>). The remaining liquid in the tank was evaporated to dryness between October 13, 2006 and February 15, 2007. A subsequent video inspection on March 17, 2007, indicated no remaining free liquid was present (Olinger 2007d).	
(64)	A leak assessment was performed because of a steady, predictable liquid level decrease of approximately 0.33 in./year since the early 1980s. The tank was designated as an "assumed leaker" in 1985, but had no record of a formal leak assessment. The leak assessment report was issued on October 10, 2007 (RPP-ASMT-35057, Tank 240-S-302 Leak Assessment Report).	Table 5-2
	A total of 6,265 gal of supernatant was pumped from the tank between September 21, 2008 and September 28, 2008. A solids level of 14.12 in. (1,361 gal) was measured with an ENRAF densitometer on September 9, 2008. A post-pumping visual inspection showed a small 1-ft wide by 10-ft long pool of liquid centered beneath the pump, corresponding to less than 6 gal of free liquid. The remaining volume is estimated to be 1,360 to 1,660 gal, based on ENRAF and densitometer readings in different risers, and assuming that the solids are level across the tank.	
(65)	A leak assessment was performed because of the 0.7-in. level decrease between January 2004 and February 2006. The leak assessment concluded that a tank leak was the most likely explanation for the level trend. The leak assessment report was issued on May 12, 2006 (RPP-RPT-29711, <i>Tank 241-UX-302A Leak Assessment Report</i>).	Table 5-2
	Pumping of the remaining free liquid from the tank was completed October 25, 2006 (Schepens 2006e). An estimated 75 to 110 gal of sludge and 10 gal of free liquid remained in the tank (RPP-RPT-31779, 241-UX-302A Catch Tank Liquid Mitigation Completion Report).	
	Following additional liquid intrusion, the tank was pumped August 27, 2009 (RPP-RPT-42789, Completion of Removal of Pumpable Liquid From 241-UX-302A), June 21, 2012, to August 7, 2012 (Work Package TFC-WO-11-5930 WCN-2), and May 3, 2015 (Work Order #WO-163708). ENRAF liquid level readings estimate that approximately 140 gallons of sludge and liquid remain in the tank.	

Table 6-1. Waste Tank Summary Report Endnotes (8 pages)

No.a	Comment/Reference	Location
(66)	A leak assessment was performed because of a 1.25-in. liquid level decrease between July 2006 and November 2006. The leak assessment concluded that the level decrease was the result of evaporation from an operating exhauster connected to catch tank 241-ER-311. This was confirmed when the exhauster was shut down and the liquid level stabilized. The tank remains classified as a "sound" tank. The leak assessment report was issued on June 25, 2007 (RPP-ASMT-33741, Tank 241-EW-151 Leak Assessment Report).	Table 5-2
(68)	241-AX-151 consists of four 50-gal diverter tanks (Tanks $D-G$) located in individual cells and the approximate 12,200-gal capacity 241-AX-151-CT catch tank (stainless steel lined concrete vault and sump) receiving drainage from the pump pit and the four cells.	Table 5-1
(69)	204-AR Customer Waste Unloading Facility includes a 1,500-gal catch tank enclosed in a stainless steel lined pit and pit sump, combined capacity of the catch tank and pit are 4,550 gal (WHC-SD-WM-SAR-040, Safety Analysis Report for the 204-AR Waste Unloading Facility).	Table 5-1
(70)	244-CR Vault contains two 40-kgal tanks, CR-011 and CR-001, and two 15-kgal tanks, CR-002 and CR-003, in individual cells. The contents of the 244-CR Vault cells were pumped to Tank C-104 during retrieval of Tank C-104. Pumping was completed on March 10, 2010 (RPP-RPT-45845, Completion of Pumpable Liquids Removal from 244-CR Vault). The completion letter was sent to ORP on April 28, 2010 (Dunning 2010). Tank volumes except tank CR-001 are from RPP-RPT-24257, 244-CR Vault Liquid Level Assessment and Video Inspection Completion Report. Following WRPS-PER-2012-0724, quarterly monitoring of Tank CR-001 was implemented in April 2013 by installation of an ENRAF monitoring device; the volume is derived from RPP-CALC-24219, 244-CR Vault Tank and Cell Volume Calculations.	Table 5-1
(71)	Tank AZ-301 is an active part of the DST system.	Table 5-1
(72)	244-AR vault was interim-stabilized in 2003 (RPP-12051, 244-AR Vault Interim Stabilization Completion Report). The waste volumes reported in Table 5-2 are taken from that report. The tanks and cell sumps in the 244-AR Vault are monitored quarterly for signs of intrusion.	Table 5-1
(74)	Records in the waste information data system indicate that Tank 244-UR-004 did not contain radioactive material. The tank was used to stage nitric acid to the other 244-UR vault tanks during the uranium recovery process in the 1950s.	Table 5-2
(75)	On August 1, 2002, a video surveillance at the 242-TA receiver vault revealed that catch tank TA-R1 was floating off its foundation due to liquid at a depth of approximately 10 ft in the vault. It was observed that associated piping was damaged. Approximately 7,000 gal of liquid had accumulated in the vault. Pumping the liquid from the vault and resealing the cover plate to prevent further intrusion were completed November 26, 2003. The remaining liquid volume in the vault was not reported (Occurrence Report RP-CHG-TANKFARM-2002-0083, "Video Surveillance Reveals Catch Tank TA-R1 Floating Off Of Its Foundation at 242-TA Vault").	Table 5-2
(76)	Video surveillance of 242-T-135 was prompted by the discovery of approximately 7,000 gal of water in the 242-TA receiver vault on August 1, 2002. There was no report of water present (Occurrence Report RPCHG-TANKFARM-2002-0083).	Table 5-2
(77)	Removed from service on March 23, 2001 (Occurrence Report RP-CHG-TANKFARM-2001-0014, "Catch Tank 152-AX Was Identified as a Potential Leaking Tank").	Table 5-1
(79)	Tank AX-102 integrity status was changed from "assumed leaker" to "sound" per RPP-ASMT-42628, Tank 241-AX-102 Integrity Assessment Report.	Table 4-2
(81)	Tank AX-104 integrity status was changed from "assumed leaker" to "sound" per RPP-ASMT-57574, <i>Tank 241-AX-104 Integrity Assessment Report</i> .	Table 4-2
(82)	Partially filled with grout February 1991, determined to be an assumed leaker after leak tests. No surface level or intrusion readings obtainable. Tank S-304 replaced 241-S-302A.	Table 5-2

Table 6-1. Waste Tank Summary Report Endnotes (8 pages)

No.a	Comment/Reference	Location
(83)	241-TX-302-B(R) replaced 241-TX-302B and a new 241-TX-302B later replaced 241-TX-302B(R).	Table 5-2
(84)	244-U-TK and 244-U-Sump were never placed in service. Per RPP-RPT-58156, "Tank 244-U was originally intended as the saltwell receiver for 241-U tank farm tanks. However the tank was bypassed and never received saltwell waste."	Table 5-2
(85)	 The following references provide additional information for the listed tanks: Baumhardt, 1989: Tank B-101, B-103, B-105, B-107, B-110, B-111, B-112, B-203, B-204, BX-101, BX-102, BX-108, BX-110, BX-111, BY-105, BY-106, BY-107, C-101, C-203, S-104, SX-111, SX-112, SX-113, SX-114, T-103, T-106, T-107, T-109, TX-105, TX-107, TX-110, TX-113, TX-114, TX-115, TX-116, TX-117, TY-103, TY-104, TY-105, TY-106, U-101, U-104, U-110, and U-112 	Table 4-2
	 Clark, 2012: Tank AY-102 Groth, 1987: Tanks C-201, C-202, and C-204 	
	• PNL-4688, 1983: Tanks A-104, BY-103, BY-108, and SX-107	
	 RHO-RE-SR-14, 1984: Tank B-201 	
	• RPP-ASMT-46452, 2010: Tank C-105	
	• RPP-RPT-54964, 2014: Tank T-111	
	 WHC-MR-0300, 1992: Tank SX-108 WHC-MR-0301, 1992: Tank SX-109 	
	• WHC-MR-0302, 1992: Tank SX-115	
	• WHC-TANKFARM-1992-0073, 1992: Tank T-101	
	 WHC-TANKFARM-1994-0009, 1994: Tank T-111 	
(86)	See RPP-RPT-50799, 2015, Suspect Water Intrusion in Single-Shell Tanks, Revision 2, for basis for intrusion decision and intrusion rates. Tanks SX-102 and T-111 are only discussed in Appendix B of RPP-RPT-50799 since the videos in these two tanks were obtained for reasons other than intrusion investigation.	Table 4-3, Table 4-4
(87)	T-111 values do not include the volume reduction associated with the current exhauster operation on the tank. The tank T-111 volume will be updated following completion of exhauster operation.	Table 4-1
(88)	See RPP-RPT-58849, 2015, Fiscal Year 2015 Visual Inspection Report for Single-Shell Tanks, Revision 0, for basis for intrusion decision.	Table 4-4
(89)	The Solids Volume Update is the date of the most recent BBI estimate or for tanks undergoing retrieval it is the date of the most recent engineering volume estimate.	Table 4-1
(90)	Tank AY-102 nominal waste volume estimate – Total waste 40,178 gal remaining at the end of June 2016, based on the retrieval engineer's data.	Table 2-1, Table 4-1
end	e following endnotes have been deleted from this report: 7, 36-42, 61-62, 67, 73, 78, and 80. The dnote numbering has been retained; deleted endnote numbers have been retired to maintain consist numbering of the remaining endnotes.	
DOE DST Ecolo ORP	= U.S. Department of Energy SST = single-shell tank = double-shell tank TWINS = Tank Waste Information Network ogy = Washington State Department of Ecology WAC = Washington Administrative Co = U.S. Department of Energy, Office of River Protection	

6.2 REFERENCES

- 24950-WTP-ICD-MG-019, 2013, ICD 19 Interface Control Document for Waste Feed, Rev. 6, Bechtel National, Inc., Richland, Washington.
- Baumhardt, R. J., 1989, "Single Shell Tank Leak Volumes," (Letter 8901832B R1 to R. E. Gerton, U.S. Department of Energy, Richland Operations Office, May 15), Westinghouse Hanford Company, Richland, Washington.
- Catlin, R. J., 1980, Assessment of the Surveillance Program of the High-Level Waste Storage Tanks at Hanford, Office of Environmental Compliance and Review, U.S. Department of Energy, Washington, D.C.
- Clark, W. C., 2012, "Contract Number DE AC27 08RV1480 Washington River Protection Solutions, LLC Tank 241-AY-102 Primary Tank Leak Integrity Change from Sound to Assumed Leaker, and Double-Shell Waste Tank Leak Integrity Definitions," (Letter WRPS-1204634 to T. W. Fletcher, U.S. Department of Energy, Office of River Protection, November 13), Washington River Protection Solutions, LLC, Richland, Washington.
- DOE O 435.1, 2001, *Radioactive Waste Management*, Change 1 (Certified 2007), U.S. Department of Energy, Washington, D.C.
- Dunning, A. B., 2010, "Contract Number DE AC27 08RV14800 Washington River Protection Solutions LLC Completion of Performance Based Incentive 1.5, Fee Bearing Milestone 1.5.1, Remove Liquids from the Secondary Containment of the 244-CR Vault Request For Incremental Fee Approval," (Letter WRPS-1000848 to S. E. Bechtol, U.S. Department of Energy, Office of River Protection, April 28), Washington River Protection Solutions, LLC, Richland, Washington.
- Ecology, EPA, and DOE, 1989, Hanford Federal Facility Agreement and Consent Order Tri-Party Agreement (TPA), as amended, Washington State Department of Ecology, U.S. Environmental Protection Agency, and U.S. Department of Energy, Olympia, Washington.
- Fletcher, T. W., 2013a, "The U.S. Department of Energy, Office of River Protection (ORP) Submits the Retrieval Completion Certification and Report for Tank 241-C-104," (Letter 13-TF-0018 to J. A. Hedges, Washington State Department of Ecology, March 21), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Fletcher, T. W., 2013b, "The U.S. Department of Energy, Office of River Protection (ORP) Submits the Retrieval Completion Certification and Report for Tank 241-C-108," (Letter 13-TF-0025 to J. A. Hedges, Washington State Department of Ecology, May 1), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Groth, D. R., 1987, "Liquid Level Losses in Tanks 241-C-201, 202, and 204," (Internal Memorandum 65950-87-517 to R. J. Baumhardt, July 1), Westinghouse Hanford Company, Richland, Washington.
- HNF-3233, 1998, Re-Analysis of SX Farm Leak Histories with the Historical Leak Model Rev. 1 (HLMr1), Rev. 1, Washington River Protection Solutions, LLC, Richland, Washington.

- HNF-3484, 2009, *Double-Shell Tank Emergency Pumping Guide*, Rev. 10, Washington River Protection Solutions, LLC, Richland, Washington.
- HNF-5985, 2000, *ER-311 Flammable Gas Response and Findings*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- HNF-EP-0182, 2005, Waste Tank Summary Report for Month Ending September 30, 2005, Rev. 210, CH2M HILL Hanford Group, Inc., Richland, Washington.
- HNF-SD-RE-TI-178, 2005, Single Shell Tank Interim Stabilization Record, Rev. 9, CH2M HILL Hanford Group, Inc., Richland, Washington.
- HNF-SD-WM-OCD-015, 2016, *Tank Farms Waste Transfer Compatibility Program*, Rev. 41, Washington River Protection Solutions, LLC, Richland, Washington.
- Jensen, L., and Merril, J. A., 1989, "Estimation of Single Shell Tank Leak Volumes," (Internal Letter 12710-89-042 to R. E. Raymond, March 28), Westinghouse Hanford Company, Richland, Washington.
- Lyon, J. J., 2005, "Tank Farm Vadose Zone Contamination Volume Estimates, RPP-23405,
 Revision 1, released September 6, 2005; Waste Tank Summary Report for August and
 September 2005, HNF-EP-0182, Revisions 209 and 210," (Letter to R. J. Schepens,
 U.S. Department of Energy, Office of River Protection, December 22), Washington State
 Department of Ecology, Richland, Washington.
- Olinger, S. J., 2007a, "Submittal of Retrieval Data Report (RDR) for Single-Shell Tank 241-C-103, RPP-RPT-33060, Revision 0," (Letter 07-TPD-026 to J. Hedges, Washington State Department of Ecology, May 21), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Olinger, S. J., 2007b, "Submittal of Demonstration Retrieval Data Report (RDR) for Single-Shell Tank 241-C-204, RPP-RPT-34062, Revision 0," (Letter 07-TPD-043 to J. Hedges, Washington State Department of Ecology, August 9), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Olinger, S. J., 2007c, "Submittal of Retrieval Data Report (RDR) for Single-Shell Tank 241-S-112, RPP-RPT-35112, Revision 0," (Letter 07-TPD-066 to J. Hedges, Washington State Department of Ecology, December 21), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Olinger, S. J., 2007d, "Submittal of Notification of Completion of Liquid Removal from Catch Tank 241-ER-311," (Letter 07-TOD-026 to J. Hedges, Washington State Department of Ecology, March 30), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- OSD-T-151-00007, 2016, Operating Specifications for the Double-Shell Storage Tanks, Rev. 19, Washington River Protection Solutions, LLC, Richland, Washington.
- PNL-4688, 1983, Assessment of Single-Shell Tank Residual Liquid Issues at Hanford Site, Washington, Pacific Northwest Laboratory, Richland, Washington.
- RHO-RE-SR-14, 1984, *Waste Status Summary*, Rockwell Hanford Operations, Richland, Washington.

- RP-CHG-TANKFARM-2001-0014, 2001, "Catch Tank 152-AX Was Identified as a Potential Leaking Tank," CH2M HILL Hanford Group, Inc., Richland, Washington.
- RP-CHG-TANKFARM-2002-0083, 2002, "Video Surveillance Reveals Catch Tank TA-R1 Floating Off Of Its Foundation at 242-TA Vault," CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-10006, Methodology and Calculations for the Assignment of Waste Groups for the Large Underground Waste Storage Tanks at the Hanford Site, Rev. 13, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-12051, 2003, 244-AR Vault Interim Stabilization Completion Report, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-13019, 2003, *Determination of Hanford Waste Tank Volumes*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-20577, 2007, Stage II Retrieval Data Report for Single Shell Tank 241-C-106, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-23405, 2005, *Tank Farm Vadose Zone Contamination Volume Estimates*, Rev. 1, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-29441, 2006, *Post-Retrieval Waste Volume Determination for Single Shell Tank 241-C-201*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-32681, 2013, Process to Assess Tank Farm Leaks in Support of Retrieval and Closure Planning, Rev. 2, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ASMT-33741, 2007, *Tank 241-EW-151 Leak Assessment Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-ASMT-35057, 2007, *Tank 240-S-302 Leak Assessment Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-ASMT-38219, 2008, *Tank 241-C-110 Leak Assessment Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-ASMT-39155, 2008, *Tank 241-C-111 Leak Assessment Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-ASMT-42278, 2009, *Tank 241-A-103 Leak Assessment Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ASMT-42628, 2014, *Tank 241-AX-102 Integrity Assessment Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ASMT-46452, 2010, *Tank 241-C-105 Leak Assessment Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ASMT-47140, 2010, *Tank 241-SX-110 Leak Assessment Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ASMT-48143, 2011, *Tank 241-SX-104 Leak Assessment Completion Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.

- RPP-ASMT-53793, 2012, *Tank 241-AY-102 Leak Assessment Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ASMT-57574, 2014, *Tank 241-AX-104 Integrity Assessment Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-24219, 2005, 244 CR Vault Tank and Cell Volume Calculations, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-CALC-33163, 2007, Tank Waste Volume and Level Calculations in Dome Space for 241-AP Tank Farm Up to 460 Inches, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-CALC-52903, 2014, Retrieval Performance of Tank 241-C-107 Using the Bulk Mobile Arm Retrieval System, Rev. 3, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-54266, 2013, Post-Hard Heel Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-108, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-54284, 2013, Post-Hard Heel Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-104, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-54759, 2013, Post-Hard Heel Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-019, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-56399, 2013, Post-Hard Heel Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-110, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-56434, 2013, Post-Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-101, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-56856, 2014, Estimated Waste Volume Remaining in Single-Shell Tank 241-C-112 after Hard Heel Retrieval, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-60933, 2016, Residual Waste Volume of Tank 241-C-105 Following Operations of MARS-V System, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ENV-33418, 2012, *Hanford C Farm Leak Assessments Report*, Rev. 2A, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ENV-37956, 2014, Hanford 241-A/AX Farm Leak Inventory Assessment Report, Rev. 2, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ENV-39658, 2010, *Hanford SX-Farm Leak Assessments Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.

- RPP-PLAN-55112, 2012, September 2012 Single-Shell Tank Waste Level Increase Evaluation Plan, Rev. 1, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-PLAN-55113, 2013, March 2013 Single Shell Tank Waste Level Decrease Evaluation Plan, Rev. 1, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-24257, 2005, 244-CR Vault Liquid Level Assessment and Video Inspection Completion Report, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-26475, 2008, *Retrieval Data Report for Single Shell Tank 241-C-203*, Rev. 1A, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-29095, 2006, Retrieval Data Report for Single Shell Tank 241-C-202, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-29163, 2006, *Tank 241-ER-311 Leak Assessment Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-29711, 2006, *Tank 241-UX-302A Leak Assessment Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-31779, 2006, 241-UX-302A Catch Tank Liquid Mitigation Completion Report, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-33060, 2007, *Retrieval Data Report for Single Shell Tank 241-C-103*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-34062, 2007, Retrieval Data Report for Single Shell Tank 241-C-204, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RRP-RPT-35112, 2007, *Retrieval Data Report for Single Shell Tank 241-S-112*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-42296, 2010, *Hanford TY-Farm Leak Assessments Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-42789, 2009, Completion of Removal of Pumpable Liquid From 241-UX-302A, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-45147, 2016, Derivation of Best-Basis Inventory for Tank 241-C-108 as of January 1, 2016, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-45845, 2010, Completion of Pumpable Liquids Removal from 244-CR Vault, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-46616, 2016, Derivation of Best-Basis Inventory for Tank 241-C-104 as of January 1, 2016, Rev. 8, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-48459, *Derivation of Best-Basis Inventory for Tank 241-C-111 as of April 1, 2016*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-50799, 2015, Suspect Water Intrusion in Single-Shell Tanks, Rev. 2, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-51343, 2016, Derivation of Best-Basis Inventory for Tank 241-C-109 as of January 1, 2016, Washington River Protection Solutions, LLC, Richland, Washington.

- RPP-RPT-52516, 2015, Derivation of Best-Basis Inventory For Tank 241-C-112 as of March 3, 2015, Rev. 3, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-54964, 2014, Evaluation of Tank 241-T-111 Level Data and In Tank Video Inspection, Rev. 2, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-57458, 2016, Derivation of Best-Basis Inventory for Tank 241-C-102 as of March 16, 2016, Rev. 6, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-58071, 2016, Derivation of Best-Basis Inventory for Tank 241-C-105 as of May 1, 2016, Washington River Protection Solutions, LLC, Richland, Washington.RPP-RPT-58156, 2014, Basis for Miscellaneous Underground Storage Tanks and Special Surveillance Facilities Waste Volumes Published in HNF-EP-0182 Revision 320 "Waste Tank Summary Report for Month Ending August 31, 2014," Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-58788, 2015, Retrieval Completion Certification Report For Tank C-102, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-58849, 2015, Fiscal Year 2015 Visual Inspection Report for Single-Shell Tanks, Revision 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-59004, 2015, Post Retrieval Camera. CAD Modeling System Waste Volume Estimate for Tank 241-C-102, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-59556, 2016, *Tank 241-AY-102 Monthly Monitoring Report June 2016*, Washington River Protection Solutions, LLC, Richland, Washington.
- Sax, S. M., 2010, "Contract Number DE AC27 08RV14800 Washington River Protection Solutions, LLC Transmittal of the Single-Shell Tank Interim Stabilization Evaluation Report for Tank 241-S-102," (Letter WRPS-1000772 R1 to S. L. Charboneau, U.S. Department of Energy, Office of River Protection, June 1), Washington River Protection Solutions, LLC, Richland, Washington.
- Schepens, R. J., 2006a, "Process for Reaching Agreement on Tank Farm Vadose Zone Leak Loss Estimate," (Letter 06-TPD-059 to J. Hedges, Washington State Department of Ecology, August 18), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Schepens, R. J., 2006b, "Submittal of the Demonstration Retrieval Data Report (RDR) for Single-Shell Tank 241-C-201, RPP-RPT-30181, Revision 0A," (Letter 06-TPD-071 to J. Hedges, Washington State Department of Ecology, November 2), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Schepens, R. J., 2006c, "Submittal of Demonstration Retrieval Data Report (RDR) for Single-Shell Tank C-202, RPP-RPT-29095, Rev. 0," (Letter 06-TPD-051 to J. Hedges, Washington State Department of Ecology, July 31), U.S. Department of Energy, Office of River Protection, Richland, Washington.

- Schepens, R. J., 2006d, "Submittal of Demonstration Retrieval Data Report (RDR) for Single-Shell Tank C-203, RPP-RPT-26475, Rev. 1," (Letter 06-TPD-005 to J. Hedges, Washington State Department of Ecology, January 18), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Schepens, R. J., 2006e, "Notification of Completion of Pumping Liquids from Catch Tank 244-UX302A and Start of Evaporation of Liquid from Catch Tank 241-ER-311," (Letter 06-TOD-090 to J. Hedges, Washington State Department of Ecology, November 1), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- SD-WM-SAR-006, 1986, Single-Shell Tank Isolation Safety Analysis Report, Rev. 2, Rockwell Hanford Operations, Richland, Washington.
- Smith, K. W., 2013a, "The U.S. Department of Energy, Office of River Protection (ORP)
 Submits the Retrieval Completion Certification and Report for Tank 241-C-109," (Letter 13-TF-0037 to J. A. Hedges, Washington State Department of Ecology, June 4),
 U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2013b, "The U.S. Department of Energy, Office of River Protection (ORP)
 Submits the Retrieval Completion Certification and Report for Tank 241-C-108," (Letter 13-TF-0120 to J. A. Hedges, Washington State Department of Ecology, November 27),
 U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2014a, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification and Report for Tank 241-C-110," (Letter 14-TF-0007 to J. A. Hedges, Washington State Department of Ecology, January 29), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2014b, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification and Report for Tank 241-C-101," (Letter 14-TF-0113 to J. A. Hedges, Washington State Department of Ecology, September 24),
 U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2014c, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification and Report for Tank 241-C-107," (Letter 14-TF-0114 to J. A. Hedges, Washington State Department of Ecology, September 30), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2014d, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification and Report for Tank 241-C-112," (Letter 14-TF-0115 to J. A. Hedges, Washington State Department of Ecology, September 30), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2014e, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification and Report for Tank 241-C-104," (Letter 14-TF-0013 to J. A. Hedges, Washington State Department of Ecology, February 18), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2014f, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification and Report for Tank 241-C-109," (Letter 14-TF-0020 to J. A. Hedges, Washington State Department of Ecology, March 13), U.S. Department of Energy, Office of River Protection, Richland, Washington.

- Smith, K. W., 2014g, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification and Report for Tank 241-C-110," (Letter 14-TF-0086 to J. A. Hedges, Washington State Department of Ecology, August 6), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2015a, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification Report for Tank 241-C-102," (Letter 15-TF-0116 to J. A. Hedges, Washington State Department of Ecology, November 30), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2015b, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification Report for Tank 241-C-101," (Letter 15-TF-0099 to J. A. Hedges, Washington State Department of Ecology, September 24), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2015c, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification Report for Tank 241-C-112," (Letter 15-TF-0098 to J. A. Hedges, Washington State Department of Ecology, September 30), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2015d, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification Report for Tank 241-C-107," (Letter 15-TF-0086 to J. A. Hedges, Washington State Department of Ecology, September 14), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- TFC-ENG-CHEM-D-42, 2013, "Tank Leak Assessment Process," Rev. B-7, Washington River Protections Solutions, LLC, Richland, Washington.
- TFC-WO-11-5930 WCN-2, 2012, "241-UX-302A Pumping Liquid out of Tank," Washington River Protections Solutions, LLC, Richland, Washington.
- WAC 173-303-070, "Dangerous Waste Regulations," Section 70, "Designation of Dangerous Waste," *Washington Administrative Code*, as amended, Washington State Department of Ecology, Olympia, Washington.
- WHC-EP-0410, 1991, *Tank 241-A-105 Evaporation Estimate 1970 Through 1978*, Westinghouse Hanford Company, Richland, Washington.
- WHC-MR-0132, 1990, A History of the 200 Area Tank Farms, Westinghouse Hanford Company, Richland, Washington.
- WHC-MR-0264, 1991, *Tank 241-A-105 Leak Assessment*, Westinghouse Hanford Company, Richland, Washington.
- WHC-MR-0300, 1992, *Tank 241-SX-108 Leak Assessment*, Westinghouse Hanford Company, Richland, Washington. WHC-MR-0301, 1992, *Tank 241-SX-109 Leak Assessment*, Westinghouse Hanford Company, Richland, Washington.
- WHC-MR-0302, 1992, *Tank 241-SX-115 Leak Assessment*, Westinghouse Hanford Company, Richland, Washington.
- WHC-SD-EN-TI-185, 1993, Assessment of Unsaturated Zone Radionuclide Contamination Around Single Shell Tanks 241-C-105 and 241-C-106, Rev. 0-A, Westinghouse Hanford Company, Richland, Washington.

- WHC-SD-WM-SAR-040, 1991, Safety Analysis Report for the 204-AR Waste Unloading Facility, Rev. 1, Westinghouse Hanford Company, Richland, Washington.
- WHC-SD-WM-TI-356, 1988, *Waste Storage and Leak Detection Criteria*, Rev. 0, Westinghouse Hanford Company, Richland, Washington.
- WHC-TANKFARM-1992-0073, 1992, "Apparent Decrease in Liquid Level in Single Shell Underground Storage Tank 241-T-101, Leak Suspected; Investigation Continuing," Westinghouse Hanford Company, Richland, Washington.
- WHC-TANKFARM-1994-0009, 1994, "Apparent Liquid Level Decrease in Single Shell Underground Storage Tank 241-T-111; Declared an Assumed Re-Leaker," Westinghouse Hanford Company, Richland, Washington.

APPENDIX A – GLOSSARY

Term (abbreviation)	Definition or expansion		
Administratively Interim Stabilized	A tank that meets interim stabilization criteria without the use of a jet pump, typically tanks that contained small waste inventories or experienced high rates of evaporation.		
Annulus	The space between the inner and outer shells in DSTs only. Drain channels in the insulating and/or supporting concrete carry any leakage to the annulus space where ENRAF gauges are installed. The ENRAF gauges are the primary means of leak detection for all DSTs. The leak detection system may not be replaced by, but may be supplemented by, the operation of an annulus ventilation system CAM.		
Annulus Pump Pit	The DST concrete pit used for the pump and piping required to empty waste from the annular space between the primary tank and secondary tank in the event of a leak from the primary tank. The annulus pump pit is connected to the DST center pump pit via installed underground piping; from the center pump pit, the waste will be returned to the primary tank or transferred to another DST. Primary tank emergency pumping using the annulus pump pit is described in HNF-3484. ^a		
Assumed Leaker ^b	The integrity classification of a waste storage tank for which surveillance data indicates a loss of liquid to the environment attributed to a breach of integrity.		
Assumed Leaker – Primary Tank ^b	The integrity classification of a DST for which surveillance data indicate a loss of liquid attributed to a breach of primary tank integrity.		
Characterization	An understanding of the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to ensure safe storage and interim operation, and ultimate disposition of the waste.		
Closure	Final closure of the operable units (tank farms) is defined as regulatory approval of completion of closure actions and commencement of post-closure actions. Per the <i>Hanford Federal Facility Agreement and Consent Order</i> ^c Change Control Form, Change Number M-45-02-03, all units located within the boundary of each tank farm will be closed in accordance with WAC 173-303-610. ^d		
Continuous Air Monitor (CAM)	The CAM passes a small portion of the DST annulus space exhaust airstream through filter paper that is continuously monitored for radiation. If airborne radioactive contamination is present in the annulus, it will collect on the filter paper. When the radiation count rate exceeds the preset alarm threshold, local and remote alarms are triggered.		
Drainable Interstitial Liquid (DIL)	The DIL is calculated based on saltcake and sludge volumes and calculated porosity values. Interstitial liquid is the liquid that fills the interstitial spaces of the solid waste. The sum of the interstitial liquid contained in saltcake and sludge minus an adjustment for capillary height is the initial volume of DIL. Interstitial liquid that is not held in place by capillary forces will, therefore, migrate or move with gravity.		
Drywells	Drywells are open bottom 6-in. or 8-in. steel casings placed vertically around an SST perimeter, and extending between 75 ft and 200 ft below-grade. Historically, the drywells were monitored with gross gamma radiation logging tools as part of a secondary leak monitoring system. In some cases, neutron probes were used to monitor moisture in the soil as a function of well depth, which could be indicative of tank leakage. The routine gross gamma logging data were stored electronically from 1974 through 1994; a program was initiated in 1995 to log each of the available drywells in each tank farm with a spectral gamma logging system. The spectral gamma logging system provides quantitative values for gamma-emitting radionuclides. The baseline spectral gamma logging database is available electronically. The terms "drywells" and "boreholes" are used interchangeably.		

Term (abbreviation)	Definition or expansion
ENRAF 854 ATG Level Detector	The ENRAF gauge, fabricated by Honeywell, determines waste level by detecting variations in the weight of a displacer lowered to the tank waste surface. ENRAF gauges transmit digital level data to the TMACS via an ENRAF computer interface unit. The computer interface unit allows fully remote communication with the gauge, minimizing tank farm entry.
Interim Stabilization	A tank that contains less than 50 kgal of DIL and less than 5 kgal of supernatant is interimstabilized. If a jet pump was used to achieve interim stabilization, the jet pump flow or saltwell screen inflow must also have been at or below 0.05 gal/min before interim stabilization criteria are met.
Interstitial Liquid Level	The height of the residual liquid occupying the interstitial spaces in the solid waste heel of an interim stabilized SST.
Intrusion Prevention	The administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. Under no circumstances are electrical or instrumentation devices disconnected or disabled during the intrusion prevention process (with the exception of the electrical pump), in accordance with SD-WM-SAR-006.°
Jet Pump	The centrifugal pump and jet assembly used to pump the interstitial liquid from the saltwell screen into the pump pit, nominally a 40-ft elevation rise. Pumping rates vary from 0.05 to about 4 gal/min.
Laterals	Laterals are horizontal drywells positioned 8 to 10 ft under SSTs, three per tank, to detect radionuclides in the soil that could be indicative of tank leakage. These drywells can be monitored by radiation detection probes. Laterals are located only in A and SX Farms. There are currently no functioning laterals and no plan to prepare them for use.
Leak Detection Pits	Enclosed sumps collect drainage from the concrete foundations of the four AX Farm SSTs and the 28 DSTs. In the event of a breach of containment of the SST or the DST secondary tank, the leak detection pit drain system collects leakage from the drain channels cast in the foundation and directs it to the leak detection pit where it can be pumped to a nearby sound DST. A leak is detected by an increase in the leak detection pit liquid level. Only DST leak detection pits are monitored for increases.
Liquid Observation Well (LOW)	In-tank LOWs are used for monitoring the interstitial liquid level in SSTs. The wells are usually constructed of fiberglass or TEFZEL ^f F-reinforced epoxy-polyester resin. A few LOWs are constructed of steel. Gamma and neutron probes are used to monitor changes in the interstitial liquid level and can indicate intrusions or leakage by increases or decreases in the interstitial liquid level. OSD-T-151-00031, identifies which LOWs are designated as the primary monitoring device in the SSTs. All of the SST LOWs are monitored quarterly. Two LOWs installed in DSTs SY-102 and AW-103 are used for special, rather than routine, surveillance purposes only.
Modified Sluicing	Modified sluicing sprays supernatant or water onto the surface of SST waste to mobilize it to a slurry and direct it to the inlet of the slurry pump. The pump transfers the slurry to a DST where the slurry is allowed to settle out. The clarified liquid is pumped back to the SST sluicers for reuse. The method is referred to as <i>modified sluicing</i> to differentiate it from historical <i>past-practice sluicing</i> that used significantly higher sluice pressures and flow rates, and greater volumes.
Nominal Volume of Remaining Waste	Nominal volume of remaining waste is the best estimate of residual volume following retrieval. Retrieval data reports also provide the 95 percent upper confidence level volume as the bounding estimate of remaining waste.

Term (abbreviation)	Definition or expansion		
Primary Tank	The metal inner tank of the DST structure that holds the radioactive liquid waste. The primary tank is constructed of high strength, stress-relieved steel to minimize the potential for cracking, and is monitored for corrosion and leakage once placed in service.		
Retrieval	Retrieval is the process of removing, to the maximum extent practical, all the waste from a given underground storage tank. The retrieval process is selected specific to each tank and accounts for the waste type stored and the access and support systems available. Per OSD-T-151-00031, a tank is officially in "retrieval status" if one of two conditions is met: (1) waste has been physically removed from the tank by retrieval operations, or (2) preparations for retrieval operations are directly responsible for rendering the leak or intrusion monitoring instrument "out-of-service."		
Saltcake	Saltcake is soluble salts in waste storage tanks formed by the evaporation of liquid waste from nuclear reactor fuels reprocessing, and is characterized by high porosity, interstitial liquid drainability, and crystalline texture.		
Saltwell Screen	The saltwell screen is a 10-in, diameter casing consisting of a stainless steel saltwell screen welded to a Schedule 40 carbon steel pipe. The casing and screen are to be inserted into a 12-in tank riser located in the pump pit. The stainless steel screen portion of the system extends through the tank waste to near the bottom of the tank.		
Secondary Tank	The metal outer tank of the DST structure that holds radioactive liquid waste in the event of a breach in the primary tank. The annular space between the primary and secondary tanks is equipped with continuous leak detection to provide early warning of a primary tank leak and an access pit for insertion of emergency pumping equipment.		
Sludge	Sludge is the insoluble hydrated metal oxides and fission products in waste storage tanks from nuclear reactor fuels reprocessing, and is characterized by low porosity, reduced interstitial liquid drainability, and mud-like texture.		
Sound ^a	The integrity classification of a waste storage tank for which surveillance data indicates no loss of liquid attributed to a breach of integrity.		
Supernatant	Supernatant is the liquid above the solids or in large liquid pools in waste storage tanks.		
Surface Levels	The surface level in all waste storage tanks is monitored by manual tape probes or ENRAF gauges, and recorded and transmitted via the surveillance analysis computer system.		
Thermocouple Tree	A thermocouple tree is installed in tanks to collect temperature data for process control and for determining compliance with temperature-based operating specifications. The thermocouple tree is typically a closed, 2-in. diameter steel pipe extending to within 6-in. of the tank bottom. Eighteen or more thermocouples are placed inside the pipe, spaced at vertical intervals of 6-in. to about 24-in., depending on the thermocouple design and intended purpose. Thermocouple leads terminate above-grade in a terminal box monitored locally or by TMACS. SST thermocouple trees that fail are not replaced.		
Total Waste	For purposes of this document, total waste is solids volume (sludge and saltcake, including liquids) plus supernatant.		
Weight Factor	The weight factor is an indirect method of determining the tank liquid level by measuring the air pressure necessary to overcome the hydrostatic head in an open-end vertical steel pipe terminated about 2-in. above the tank floor. The "uncorrected weight factor" is the difference between the hydrostatic head pressure in the pipe and the air pressure in the tank headspace, expressed in inches of water. To eliminate the liquid density bias that affects the uncorrected weight factor measurement, a second vertical pipe is located in the liquid, terminated 10-in. above the first pipe. The difference in hydrostatic head between the two pipes is converted to specific gravity (i.e., ratio of the liquid density to water density); the uncorrected weight factor divided by the specific gravity yields the "corrected weight factor," which is the true liquid height in the tank.		

Term (abbreviation)	Definition or expansion
Zip Cord	The zip cord is a primitive liquid level detection device consisting of a calibrated insulated wire pair to which electrodes have been attached. To make the measurement, the zip cord is slowly lowered to a point where the liquid surface is contacted by the electrodes. The liquid level reading is recorded when the portable direct current meter connected between the wire leads registers zero ohm resistance.

- ^a RHO-RE-SR-14, 1984, Waste Status Summary October 1984, Rockwell Hanford Operations, Richland, Washington.
- b Clark, W. C., 2012, "Contract Number DE AC27 08RV1480 Washington River Protection Solutions, LLC Tank 241-AY-102 Primary Tank Leak Integrity Change from Sound to Assumed Leaker, and Double-Shell Waste Tank Leak Integrity Definitions," (Letter WRPS-1204634 to T. W. Fletcher, U.S. Department of Energy, Office of River Protection, November 13), Washington River Protection Solutions, LLC, Richland, Washington.
- ^c Ecology, EPA, and DOE, 1989, *Hanford Federal Facility Agreement and Consent Order Tri-Party Agreement (TPA)*, as amended, Washington State Department of Ecology, U.S. Environmental Protection Agency, and U.S. Department of Energy, Olympia, Washington.
- d WAC 173-303-610, "Dangerous Waste Regulations," Section 610, "Closure and Post-Closure," Washington Administrative Code, as amended, Washington State Department of Ecology, Olympia, Washington.
- SD-WM-SAR-006, 1986, Single-Shell Tank Isolation Safety Analysis Report, Rev. 2, Rockwell Hanford Operations, Richland, Washington.
- f TEFZEL is a trademark of E. I. du Pont de Nemours & Company, Wilmington, Delaware.
- ^g OSD-T-151-00031, 2014, Operating Specifications for Tank Farm Leak Detection and Single-Shell Tank Intrusion Detection, Rev. 6, Washington River Protection Solutions, LLC, Richland, Washington.

CAM	=	continuous air monitor.	SST	=	single-shell tank.
DIL	=	drainable interstitial liquid.	TMACS	=	tank monitor and control system.
DST	=	double-shell tank.	WAC	=	Washington Administrative Code.
LOW	=	liquid observation well.			

DISTRIBUTION LIST

OFFSITE - USA

Number of copies	Address
2 hard copies	Congress of the United States U.S. Senate 717 Hart Senate Building Washington D.C. 20510 Senator Ron Wyden
	U.S. House of Representatives 1641 Longworth House Office Building Washington D. C. 20515 Congressman Dan Newhouse, 4th District
1 electronic only	U.S. Department of Energy-Headquarters Elizabeth Connell Elizabeth.Connell@hq.doe.gov
1 electronic only	Nicholas P. Machara nicholas.machara@em.doe.gov
1 electronic only	Jim Poppiti james.poppiti@em.doe.gov
1 electronic only	Theodore A. Wyka Theodore.wyka@em.doe.gov
1 electronic only	Kenneth Picha kenneth.picha@em.doe.gov
1 electronic only	U.S. Department of Justice Kenneth Amaditz Kenneth.Amaditz@usdoj.gov
1 hard copy	Washington State Department of Health Office of Radiation Protection 309 Bradley Boulevard, Suite 201 Richland, WA, 99352
1 hard copy	Oregon Department of Energy Nuclear Safety Division 625 Marion St. NE Salem, OR 97301-3737 Dirk Dunning, P.E.
1 electronic only	U.S. Defense Nuclear Facilities Safety Board Mark Bradisse MarkB@dnfsb.gov

TRI-CITIES

Number of copies Address Meier Architecture Engineering 1 electronic copy Anthony G. Cockbain agcockbain@meierinc.com **Tri-City Herald** Annette Cary 1 hard copy 333 West Canal Dr. Kennewick, WA 99336 1 hard copy Robert J. Cash 114 Somerset St. Richland, WA 99354-1966 1 hard copy Richard Welty 409 S. 41st Ave W. Richland, WA 99353-5005

ONSITE

Number of copies	Address	Mail Stop
	Government Accountability Office	
1 electronic only	N. K. Kintner-Meyer	A1-80
1 electronic only	J. T. Larson	A1-80
1 1	U.S. Defense Nuclear Facilities Safety Bo	
1 electronic only	P. K. Fox	S7-04
1 electronic only	D. M. Gutowski	S7-04
	U.S. Environmental Protection Agency	
1 hard copy	D. A. Faulk	A3-46
	U.S. Department of Energy	
1 electronic only	S. M. Braswell	H6-60
1 electronic only	S. J. Beehler	H6-60
1 electronic only	M. E. Burandt	H6-60
1 electronic only	J. E. Cheadle	H6-60
1 electronic only	J. A. Dowell	H6-60
1 hard copy	T. W. Fletcher	H6-60
1 electronic only	R. L. Frink	H6-60
1 electronic only	J. F. Grindstaff	H6-60
1 electronic only	B. A. Harkins	H6-60
1 electronic only	P. R. Hernandez	H6-60
1 electronic only	K. L. Higgins	H6-60
1 electronic only	D. H. Irby	H6-60
1 electronic only	J. M. Johnson	H6-60
1 electronic only	C. J. Kemp	H6-60
1 electronic only	R. J. Koll	H6-60
1 electronic only	Y. M. Levardi	H6-60
1 hard copy	S. S. Lowe	H0-57
1 electronic only	D. L. Noyes	H6-60
1 electronic only	S. H. Pfaff	H6-60
1 electronic only	R. V. Bushey	H6-60
1 electronic only	K. W. Smith	H6-60
1 electronic only 1 electronic only	B. J. Stickney W. B. Scott	H6-60 H6-60
1 electronic only	J. Shuen	H6-60
1 electronic only	D. M. Smith	H6-60
1 electronic only	D. M. Stewart	H6-60
1 electronic only	P. J. Swann	H6-60
1 hard copy	G. D. Trenchard	H6-60
1 electronic only	R. J. Valle	H6-60
1 hard copy	Reading Room (P.H. McCormick)	H2-53
1,7		
1 electronic only	Office of the Inspector General M. C. Howard	B8-27
1 electronic only	L. A. Hughes	B8-27
1 electronic only	A. S. Nielsen	B8-27
1 electronic only	T. M. O'Byrne	B8-27
1 electronic only	K. E. Otero	B8-28
1 electronic only	J. M. Pesek	B8-27
1 electronic only	L. J. Poppe	B8-27
1 electronic only	R. L. Stout	B8-27
1 electronic only	D. M. Thomas	B8-27
1 electronic only	S. Won	B8-27

Washington River Protection Solutions, LLC

	washington River 1 rotection Solutions, L	LC
Number of copies	Address	Mail Stop
1 electronic only	K. R. Bader	H0-51
1 electronic only	D. G. Baide	R2-53
1 electronic only	H. L. Baune	H0-51
1 electronic only	K. R. Beaulaurier	S5-08
1 electronic only	J. J. Brown	S5-08
1 electronic only	J. L. Castleberry	S7-02
1 electronic only	T. M. Crane	T4-70
1 electronic only	M. S. Cuttlers	S5-08
1 electronic only	J. Duarte	S5-08
1 electronic only	B. K. Everett	S5-08
1 electronic only	M. L. Farner	K8-41
1 electronic only	K. D. Frisby	S5-63
1 electronic only	J. E. Geary	S7-02
1 electronic only	R. E. Gregory	S7-68
1 electronic only	M. L. Hendrickson	H0-51
1 electronic only	J. N. Holloway	H3-22
1 electronic only	D. J. Houghton	R1-02
1 electronic only	B. A. Johnson	S5-13
1 electronic only	K. E. Sterling	S5-08
1 electronic only	N. W. Kirch	H0-51
1 electronic only	T. J. Knaff	S5-08
1 electronic only	M. A. Lindholm	H3-21
1 electronic only	M. T. Lutz	S5-08
1 electronic only	A. G. Miskho	H0-55
2 hard copies	R. J. Moore	S3-95
1 electronic only	M.S. Ornstein	H6-60
1 electronic only	A.H. Purvis	T4-70
1 electronic only	J. S. Rodriguez	S5-08
1 electronic only	R. T. Roxburgh	H3-22
1 hard copy	T. L. Sams	H0-51
1 electronic only	D. K. Smith	S5-01
1 electronic only	T. S. Synoground	S5-08
1 electronic only	M. F. Tavelli	R2-58
1 elec. & 1 hard copy	A. M. Templeton	H0-51
1 electronic only	L. E. Thompson	H0-56
1 electronic only	J. A. Voogd	R1-51
1 hard copy	WFO Shift Office	S5-08
1 hard copy	Environmental Data Mgmt Center	H6-08

CH2M Hill Plateau Remediation Contractor

Number of copies	Address	Mail Stop
1 electronic only	G. S. Thomas	R3-50

Washington State Department of Ecology

Number of copies	Address	Mail Stop
1 electronic only	J. M. Alzheimer	H0-57
1 hard copy	J. J. Lyon	H0-57
1 hard copy	N. H. Uziemblo	H0-57
1 electronic only	K. J. Wold	H0-57
1 hard copy	Library	H0-57